


# *Dual Servo Spin Welder* **User's Manual**

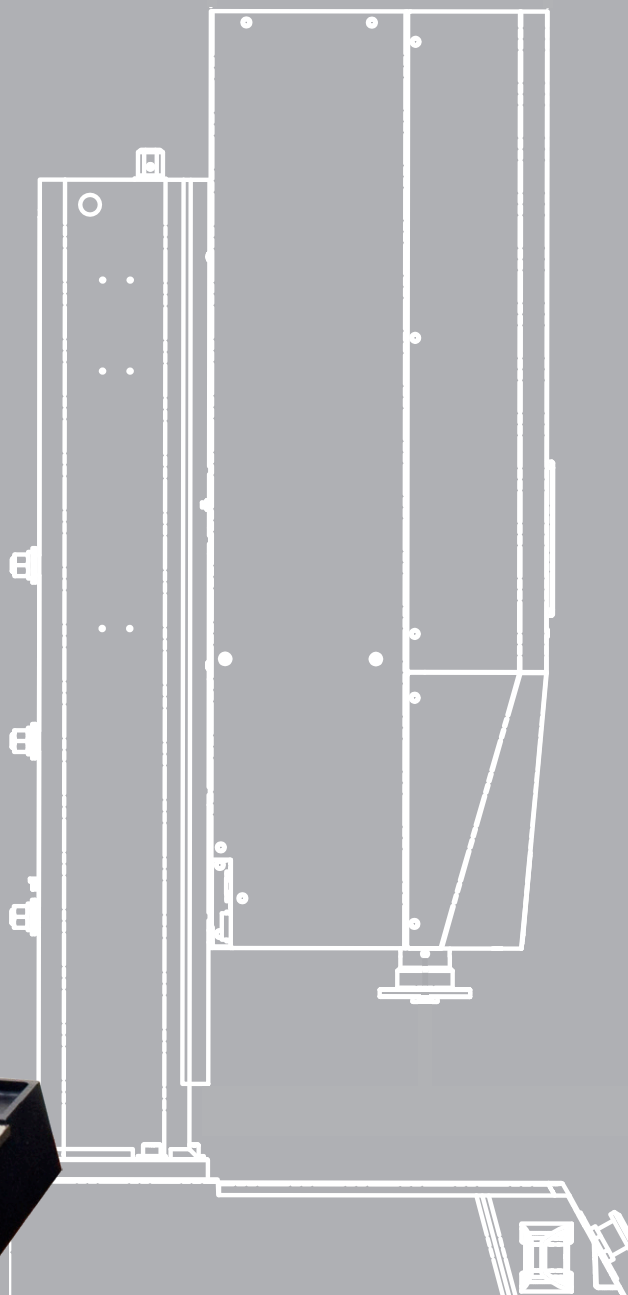

**DUKANE** Part No. 403-570-00

Dukane Intelligent Assembly Solutions • 2900 Dukane Drive • St. Charles, Illinois 60174 USA • TEL (630) 797-4900 • FAX (630) 797-4949

**ISO 9001:2000**

Dukane products are manufactured  
in ISO registered facilities



[www.dukcorp.com/us](http://www.dukcorp.com/us)

Copyright © 2008

Dukane  
Intelligent Assembly Solutions  
2900 Dukane Drive  
St. Charles, IL 60174 USA

**Notice of Rights:**

All rights reserved. No part of this manual including the interior design, cover design and icons may be reproduced, transmitted or utilized in any form or by any means, electronic, mechanical, photocopying, recording, or by any information storage and retrieval system, without written permission from Dukane Corporation.

**Notice of Liability:**

The information contained in this manual is distributed on an "As is" basis, without warranty. While every precaution has been taken in the preparation of this manual, Dukane Corporation shall not have any liability to any person or entity with respect to any liability, loss, or damaged caused or alleged to be caused directly or indirectly by the instructions contained in this manual, or by the hardware and software products described herein.

Printed in the United States of America.

Dukane Part Number: 403-570-00

Dukane ultrasonic equipment is manufactured under one or more of the following

U.S. Patents:

3,780,926 3,825,481 4,131,505 4,277,710 5,798,599 and 5,880,580.

---

# Revision History

Revision Number	Revision Summary	Date
- 00	Original release.	10/20/2008

*This page intentionally left blank*



---

# Dukane Dual Servo Spin Welder

## Contents

---

<b><i>Section 1 – Introduction</i></b>	<b><i>1</i></b>
<b><i>Section 2 – Safety Considerations</i></b>	<b><i>7</i></b>
<b><i>Section 3 – Unpacking and Setup</i></b>	<b><i>13</i></b>
<b><i>Section 4 – Display and Controls</i></b>	<b><i>21</i></b>
<b><i>Section 5 – Touch Screen Menus</i></b>	<b><i>27</i></b>
<b><i>Section 6 – Machine Operation</i></b>	<b><i>49</i></b>
<b><i>Section 7 – Optimizing Performance</i></b>	<b><i>57</i></b>
<b><i>Section 8 – Welder Data Export Software</i></b>	<b><i>65</i></b>
<b><i>Section 9 – Troubleshooting</i></b>	<b><i>71</i></b>
<b><i>Section 10 – Maintenance</i></b>	<b><i>81</i></b>
<b><i>Section 11 – Contacting Dukane</i></b>	<b><i>85</i></b>
<b><i>Section 12 – Specifications</i></b>	<b><i>89</i></b>
<b><i>Appendix A – Connector Pinouts</i></b>	<b><i>95</i></b>
<b><i>Appendix B – Tooling</i></b>	<b><i>103</i></b>
<b><i>Appendix C – Optional Features</i></b>	<b><i>107</i></b>

*This page intentionally left blank*

# SECTION 1

## Introduction

---

Important User Information . . . . .	3
Read the Manual First . . . . .	3
Notes and Tips . . . . .	3
Caution and Warnings . . . . .	3
Drawings and Tables . . . . .	3
Dual Servo Spin Welder Overview . . . . .	4
Dual Servo Spin Welder Key Features . . . . .	5

*This page intentionally left blank*

# Important User Information

## Read This Manual First

Before operating the Dual Servo Spin Welder, read this User's Manual to become familiar with the system. This will ensure correct and safe operation. The manual is organized to allow you to learn how to safely operate this system. The examples given are chosen for their simplicity to illustrate basic setup procedures.

## Notes and Tips

Throughout this manual we use **NOTES** to provide information that is important for the successful application and understanding of the system. A **NOTE** block is shown to the right.

## Cautions and Warnings

In addition, we use special notices to make you aware of safety considerations. These are the **CAUTION** and **WARNING** blocks as shown here. They represent increasing levels of important information. These statements help you to identify and avoid hazards and recognize the consequences. Different symbols also accompany the **CAUTION** and **WARNING** blocks to indicate whether the notice pertains to a general condition or practice, an electrical safety issue, a hand protection issue or other condition.

## Drawings and Tables

The figures and tables are identified by the section number followed by a sequence number. The sequence number begins with one in each section. The figures and tables are numbered separately. The figures use arabic sequence numbers (e.g. -1, -2, -3) while the tables use roman sequence numerals (e.g. -I, -II, -III). As an example, Figure 3-2 would be the second illustration in section three while Table 3—II would be the second table in section three.

### NOTE

**NOTE** statements provide additional information or highlight procedures.

### CAUTION



**CAUTION** statements identify conditions or practices that could result in damage to the equipment or other property.

### WARNING



**WARNING** statements point out conditions or practices that could result in personal injury or loss of life.



Condition  
or Practice



Electrical  
Hazard



Crush  
Hazard

# Dual Servo Spin Welder

## Overview

The Dual Servo Spin Welder excels at frictional welding of assemblies and parts which require accurate angular orientation and collapse distance. The parts can be any shape and only the weld joint must be circular. The welder uses two electric servos: a servo motor for spinning the tool, and a servo actuator for moving the machine head up and down. Both servos have high-resolution encoders, enabling accurate process control.

Dukane offers three models: SVT012VR, SVT032VR, and SVT042VR. Model differences are in the maximum speed, power and torque of the spin servo motor (the same vertical servo actuator is used in each).

*Model specifications:*

---

### **SVT012VR**

750 RPM, 4.2 HP, 47 ft-lb Torque Spin Motor

### **SVT032VR**

3,000 RPM, 4.2 HP, 16 ft-lb Torque Spin Motor

### **SVT042VR**

4,000 RPM, 2.5 HP, 10 ft-lb Torque Spin Motor

---

All models have a 5-inch stroke, a fixture throat depth of 8-inches, and a vertical maximum thrust of 700 pounds. Both SVT032VR and SVT042VR models have the same maximum vertical clearance of 21.3 inches (541 mm) between the bottom of the tooling hub and top of the mounting base. The SVT012VR model has a clearance of 20.4 inches (518 mm).

The Dual Servo Spin Welders were designed to provide a reliable, long, and economical service life and meet the applicable CE regulations.

# Key Dual Servo Spin Welder Features

- **Color touch–screen display** uses Color Active Matrix Thin–Film Transistors (TFT) for high contrast and wide viewing angle even under high ambient–lighting conditions. The 192 touch–cells provide a high performance interface.
- **Commercial subassemblies** are used to ensure a longer and more economical service life than units built with proprietary components. These readily available items also lessen the need for expensive field service calls.
- **Ultra–rigid** square support column minimizes load deflection for precise and repeatable operation.
- **Column–mounted** direct drive 2.5 or 4.2 HP spin servo motor for faster cycle times and quick deceleration to prevent bond shearing and to produce stronger joints.
- **Digital rotary encoders** are built into the servo motors for maximum reliability. The spin motor encoder accurately measures and controls the final angular orientation to within  $0.1^\circ$  (1 part in 3600), and the vertical actuator encoder measures the distance to within .0004" (0.01 mm).
- **Weld by time, number of rotations, distance (absolute or relative), and energy.** Built-in sensors give you the choice of weld methods and triggering by position or by spin torque.
- **Parameter monitoring** with programmable upper and lower limits of weld time, rotations, angular orientation, energy, peak RPM, peak torque and cycle time.
- **Weld process profiles.**  
Spin and vertical servo load and position data can be downloaded to a PC for review via RS-232.
- **Digital timer** for weld time and hold time gives precise control of the spin welding process.
- **Fixture throat depth** is a generous 8".
- **Vertical servo actuator operation** with adjustable 5" (127 mm) stroke assures quiet operation and is environmentally safe.
- **Industry-standard logic controller and motor controller** means replacement parts are readily available.
- **ISO 9001 Certification** means that the Dual Servo Spin Welder is manufactured to exacting quality standards.
- **24–month domestic warranty** assures you of reliability and quality construction.

*This page intentionally left blank*



# SECTION 2

## Safety Considerations

---

Health and Safety Tips .....9

    Plastics Health Notice ..... 10

    Run Switches ..... 10

    General Safety ..... 10

Electrical Safety..... 11

    AC Power Receptacle ..... 11

    Grounding ..... 11

Mechanical Safety ..... 11

*This page intentionally left blank*

# Health and Safety Tips

Please observe these health and safety recommendations for safe, efficient, and injury-free operation of your welder. In this manual, the term *welder* and/or *dual servo spin welder* both refer to the *Dual Servo Spin Welder*.

**Proper Installation** - Do not operate the Dual Servo Spin Welder until after the electrical system is properly installed.

**No Unauthorized Modifications** - Do not modify your Dual Servo Spin Welder in any way unless authorized to do so by Dukane Corporation. Unauthorized modifications may cause injury to the operator and/or equipment damage. In addition, unauthorized modifications will void the equipment warranty.

**Keep the Sheet Metal Intact** - Do not remove any of the protective sheet metal enclosing the motor or controls. The servo motors and drives have exposed electrical terminals which could cause injury or death if touched.

**Grounded Electrical Power** - Operate this equipment only with a properly grounded electrical connection. Refer to the NEMA Type 6-20R wiring diagram in Figure 2-1 and receptacle photo in Figure 3-5. If there is any question about the grounding of your AC power, have it checked by a qualified electrician.

**Comply with Regulations** - You may be required to add accessories to bring the system into compliance with applicable OSHA (Occupational Safety and Health Administration) regulations for machine guarding and noise exposure.

**Operate Safely** – *Keep your hands and body away from the tool head during operation. Always wear a face shield when operating the spin welder. Be extremely careful not to let long sleeves, necklaces or long hair become entangled in the spin welder during operation. Do not operate the welder if under the influence of alcohol or drugs. Read the warning labels on prescriptions to determine if your judgement or reflexes are impaired while taking drugs. If there is any doubt, do not operate the machine.*



## IMPORTANT

Always wear a face shield when operating the welder.



## CAUTION

Welded parts may be hot.



## IMPORTANT

Never operate the Dual Servo Spin Welder with the protective sheet metal removed. This is an unsafe practice and can result in injury.

## Plastics Health Notice

Before using any Dukane welding system, be sure you are familiar with OSHA regulations from the U.S. Department of Labor about the particular type of plastic(s) you are using.

When plastic materials are being processed, some of them may emit fumes and/or vapors that could be hazardous (e.g. PVC – Polyvinyl Chloride can emit chlorine gas under certain processing conditions). Make sure you use proper ventilation whenever these plastics are processed.

## Run Switches

The dual finger run switches comply with OSHA safety regulations. Using a foot switch in place of the dual finger run switches violates OSHA regulations.

## General Safety

Before performing any maintenance or service on the Dual Servo Spin Welder, locks and tags should be applied to all energy isolating switches. Anything that might restore energy to the welder must be locked out.

You may be required to add accessories to bring the system into compliance with applicable regulations for operator safety. In the United States, these regulations are administered by OSHA.

# Electrical Safety

## AC Power Receptacle

The power cord used on the Dual Servo Spin Welder has a two-blade, grounding type plug designed for 240 VAC at 20 Amps. It is designed to be plugged into a 240 VAC, 20 Amp NEMA type 6-20R receptacle as shown in Figure 2-1. Do not alter the plug or receptacle in any way.

## Grounding

It is important for operator safety that the receptacle grounding wire be installed properly and securely attached to an effectively grounded rod. The function of the ground wire is to keep the Dual Servo Spin Welder base and housing at earth potential. In the event of a short circuit from one of the AC lines to the case, the circuit breaker will open, protecting the equipment and operator. If there is any question about the grounding of your AC power, have it checked by a qualified electrician.

Grounding lugs are also provided, one on the back of the base (see Figure 2-2) and one on the back of the welder housing. You should connect a separate 14 AWG\* ground wire between these lugs and an effectively grounded metal pipe. This will minimize any external electrical interference from leaking into the Dual Servo Spin Welder control circuitry. This will not compromise the safety of the power ground.

\* 14 AWG wire has a diameter of 1.63mm or 0.064"

## Mechanical Safety

The Dual Servo Spin Welder is capable of developing substantial torque, force, and high rotational velocity. Keep your hands and body away from the tool head during operation. The spinning head is capable of inflicting serious injury. Never attempt to retrieve a part from a spinning tool head. Always wear a face shield when operating the spin welder. Be extremely careful not to let long sleeves, ties, necklaces or long hair become entangled in the welder during operation. Always turn machine power off when installing or removing tooling.

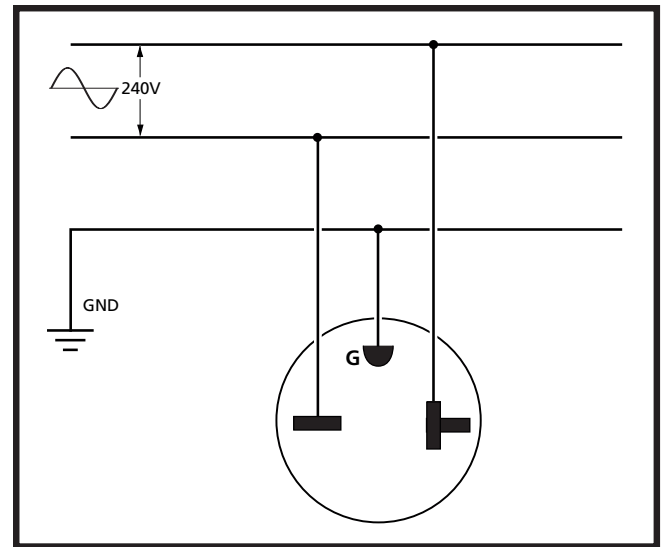


Figure 2-1 240VAC-20A Receptacle Wiring

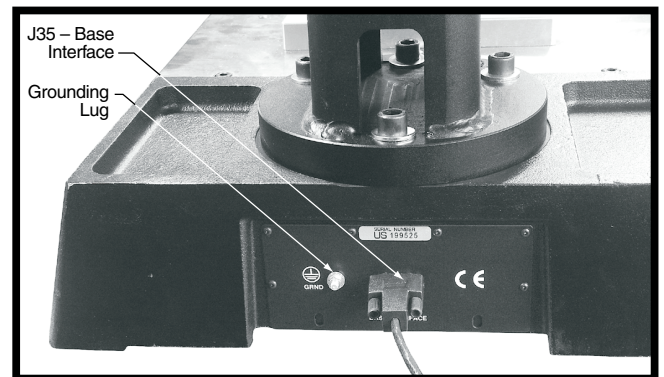


Figure 2-2 Grounding Lug on Base of Dual Servo Spin Welder



### IMPORTANT

Always turn off the AC power at the power switch before servicing or working on the welder. Failure to turn off the AC power is an unsafe practice and can result in injury or death.

*This page intentionally left blank*

## SECTION 3

# Unpacking and Setup

---

Unpacking Welder .....	15
Packing List .....	15
Work Area .....	15
Secure to Work Bench.....	16
Bench Capacity .....	16
Leveling.....	16
Mounting Holes .....	16
Tooling Hub & Fixture .....	17
AC Power .....	18
Height Adjustment .....	19
Control Connectors.....	19
Base Interface Connector .....	19
User I/O Connector .....	19
Slide Kit Connector .....	19

*This page intentionally left blank*



# Unpacking Welder

The Dual Servo Spin Welder is normally packed in a corrugated carton resting on a wooden shipping pallet. To unpack the welder follow these steps.

1. Remove the straps from the carton.
2. Open the top of the carton. Carefully remove any packing materials, cables and documentation.
3. Cut the tape at the bottom corners and unfold the flaps.
4. Remove the corrugated carton, but leave the welder on the pallet.
5. Leave the power cable wrapped up until after the welder has been placed in its working area and you are ready to begin hooking up power. This will prevent accidental kinking or pinching of the power cable.

## Packing List

After removing the shipping container, check that you have the items listed in Table 3-I. Inspect the welder for damage. Report any damage immediately to the carrier and to Dukane Ultrasonics Service at (630) 762-4900. Also see Section 11 for information on contacting Dukane. Save all shipping and packing materials so they can be inspected in processing any claims that may arise.

## Work Area

Allow sufficient area on either side of the Dual Servo Spin Welder for handling material, work pieces and fixtures. Provide ample room so that the movement of an operator or helper does not interfere with the work of another. Also be aware that under extreme conditions, small droplets of molten plastic may be spun off from the upper part.

Qty	Item	Part Number
1	Dual Servo Spin Welder	SVT012VR or SVT032VR or SVT042VR
1	Base Interface Cable	200-1124-3 or 200-1545-01
1	Dual Servo Spin Welder Manual	403-570-XX
1	CD with Dual Servo Spin Welder Utility	—

**Table 3-I** Dual Servo Spin Welder Packing List

## Securing to Work Bench

### Bench Capacity

The Dual Servo Spin Welder weighs approximately 400 lbs. (182 kg). It should be attached to a table or bench capable of supporting 650 lbs. (295 kg) to accommodate the additional force imposed by the vertical movement of the motor and slide during the spin welding operation.

Use mechanical means such as a forklift or hoist to place the servo spin welder on its work bench. There are two  $\frac{3}{4}$  inch lifting eyes located at the top of the column (see Figure 3–7) for a lifting ring or strap. Remove any remaining plastic wrap after the welder is in its final position.

### Leveling

We recommend that the Dual Servo Spin Welder be leveled to within one degree. This can be accomplished using a carpenter's level. One degree corresponds to approximately one-quarter of an inch (6 mm) deviation across the 16 inch (406 mm) width of the platen.

### Mounting Holes


The base of the Dual Servo Spin Welder has two mounting holes in the front as shown in Figure 3–1. The two holes will accept either 12mm or  $\frac{7}{16}$ " diameter bolts. We recommend that you securely attach the welder base to the work table using these mounting holes.



#### WARNING



**DO NOT LIFT** the Dual Servo Spin Welder manually. Lifting and/or moving the welder manually could result in personal injury. Use mechanical means to move and place the welder.

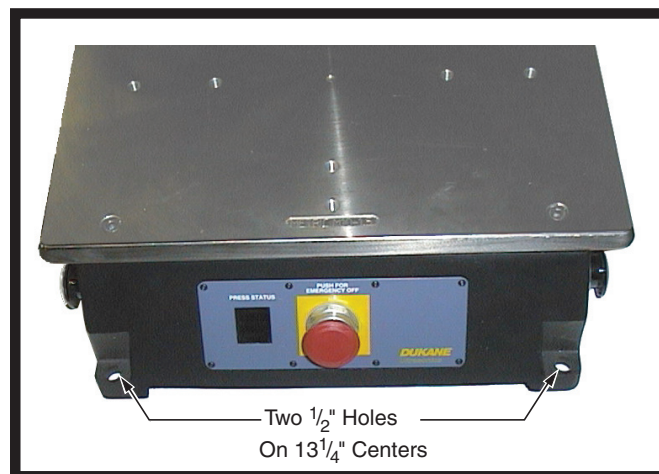


**Figure 3–1** Mounting Hole Locations on Base

# Tooling Hub & Fixture


The upper tooling attaches to a hub using four 5/16"-18 screws, spring lock washers, and flat washers.

Figure 3-2 (a & b) gives the dimensions of the tooling hubs. The hubs have precision slots to accommodate an indexing pin on the tool so that the tool can be mounted in a consistent orientation relative to the hub.


The lower tooling fixture attaches to the base platen using M10-1.5 cap screws. See Figure 3-3 for the detailed measurements of the mounting holes in the base platen.

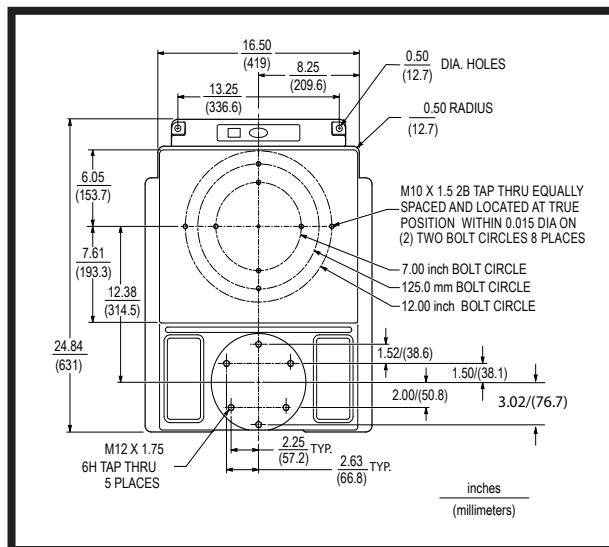

**Figure 3-3** Lower Base Fixture Mounting

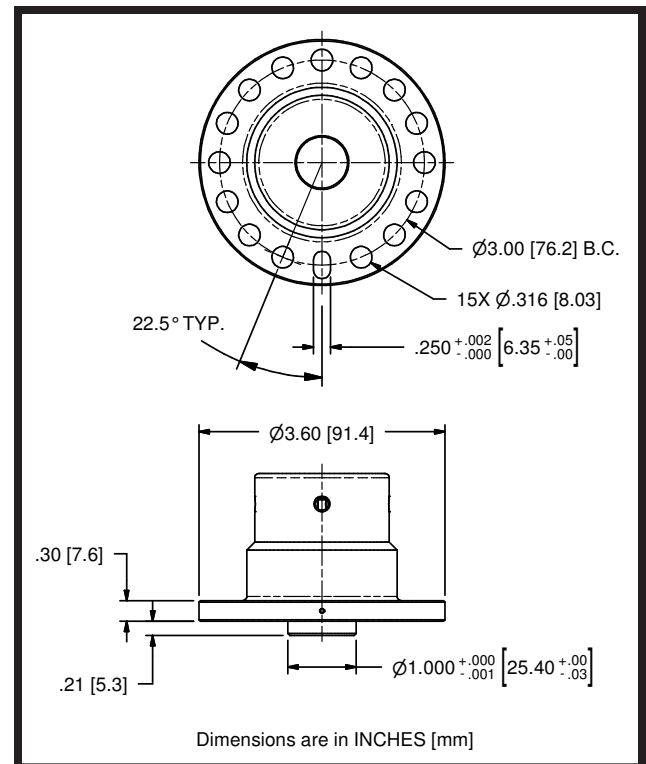

**Figure 3-2a** Upper Tooling Hub Dimensions for Models SVT032VR and SVT042VR

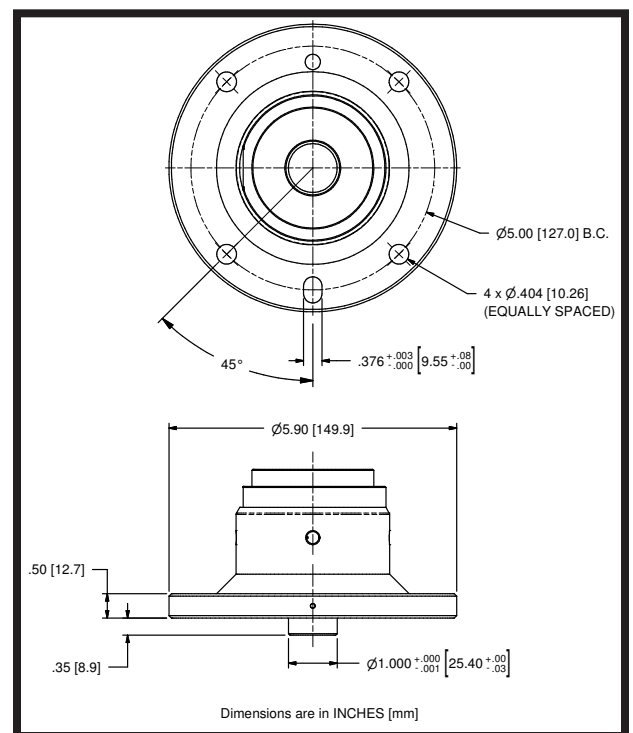

**Figure 3-2b** Upper Tooling Hub Dimensions for SVT012VR

## AC Power

The Dual Servo Spin Welder requires a 240 VAC 1-phase outlet rated at 20 Amps. All machine models use the same power cord and plug. The AC power cord is permanently attached to the welder. The other end of the cable has a 240 VAC, 1-phase plug shown in Figure 3-4. This is designed for a NEMA 6-20R configuration wall receptacle shown in Figure 3-5.

Directly below the AC cord strain relief is the AC power switch. The switch combines the functions of a power switch and a 20 Amp circuit breaker. The breaker/switch is identical on all models and is shown in Figure 3-6.



**Figure 3-4** 20-Amp 240V Plug



**Figure 3-5** 20-Amp 240V Receptacle



**Figure 3-6** AC Power Switch and Power Cord

# Head Height Adjustment

The support column features a threaded shaft for adjusting the overall height of the thruster head. The adjustment is secured by three lock nuts which prevent the thruster from moving once the overall height has been established. This is shown in Figure 3-7 and covered in detail in Chapter 6. A reference scale and index pointer are located next to the column to indicate the thruster head height.

## Control Connectors

### Base Interface Connector

On the rear of the housing is the base control input connector as shown in Figure 3-8. The Base Interface cable (Part No. 200-1124-3 or 200-1545-01) is a supplied part and is included with the welder (see Table 3-I). Connect one end of the cable to the rear thruster connector and the other end to the Base Interface connector (J35) as shown in Figure 3-7. The control cable carries the operate and emergency stop signals from the optical operate switches and abort switch on the base. If you are using custom automation, you may have separate operate and abort switches, but these still connect to the press control input on the welder. Both the base and thruster connectors are the same DB-9 type. The pinout for this connector is given in Appendix A.

### User I/O Connector

Directly above the DB-9 base interface connector is a HD-15 User I/O connector for custom automation applications. This is shown in Figure 3-8. The pinout for this connector is given in Appendix A.

### Slide Kit Connector

To the right of the DB-9 base interface connector is a round 16-pin connector for controlling the optional Slide Kits. This is shown in Figure 3-8. The pinout for this connector is given in Appendix A.

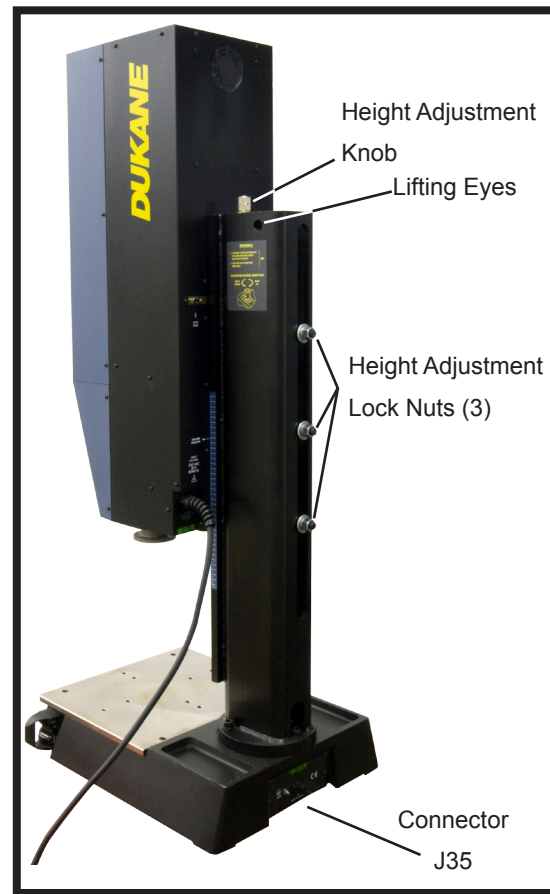


Figure 3-7 Height Adjustment and Lock Nuts



Figure 3-8 Electrical Control Connectors

*This page intentionally left blank*

# SECTION 4

## Display and Controls

---

Touch Screen Display.....	23
Operational Switches.....	24
Emergency Stop Switch .....	24
Opti-Touch Run Switches .....	25
Data I/O Connector.....	25

*This page intentionally left blank*




# Touch Screen Display


The display is a 4.6 inch (12 cm) wide by 3.5 inch (9cm) tall color LCD screen shown in Figure 4-1. It contains an integrated touch screen with 192 touch-sensitive cells arranged as 16 rows of 12 columns.

Setup parameters and mode selections are programmed through the touch screen. A closeup view of the controls is shown in Figure 4-2. The left side of the display remains visible for most of the selected functions.

The icon in the upper left corner indicates machine status. Below that are three touch cells for Run mode (RUN), Weld and Post-Weld Setup (SETUP), and Setup Utilities (TOOLS). The functions of these buttons are covered in Chapter 5. The touch cell on the right labeled Part Data displays part data for the previously welded assemblies.

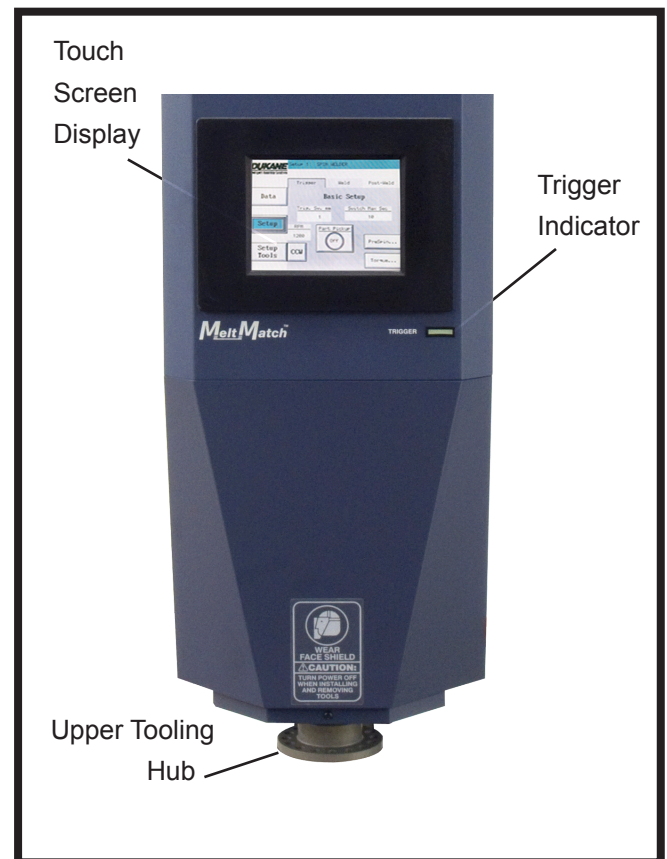

**Figure 4-1** Dual Servo Spin Welder Touch Screen Panel

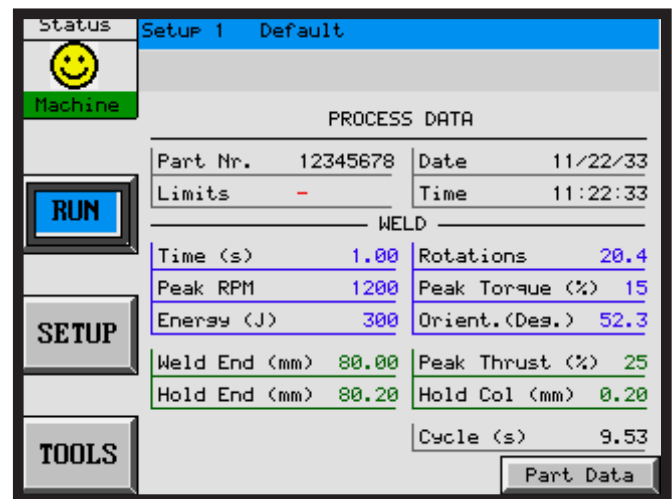

**Figure 4-2** Startup Screen

# Operational Switches

## Emergency Stop Switch

A red Emergency–Stop (E–STOP) switch is located in the center of the base as shown in Figure 4–3. The emergency stop switch must be in its reset position before the operate switches will function. To reset the Emergency Stop, twist the large red button about 45 degrees clockwise, which will cause the button to spring out. This is depicted in Figure 4–4.

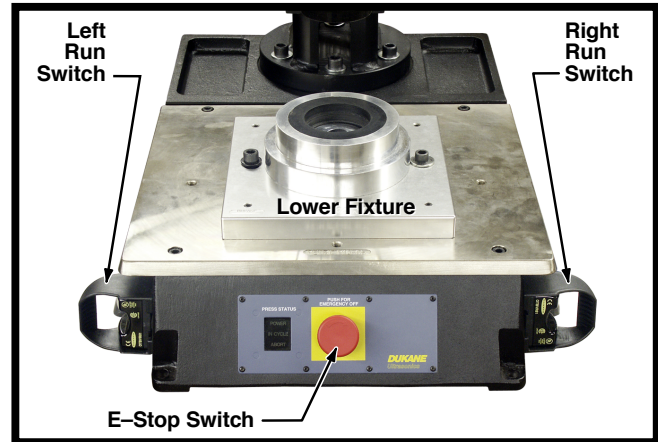


Figure 4–3 Operate Switches and E–Stop

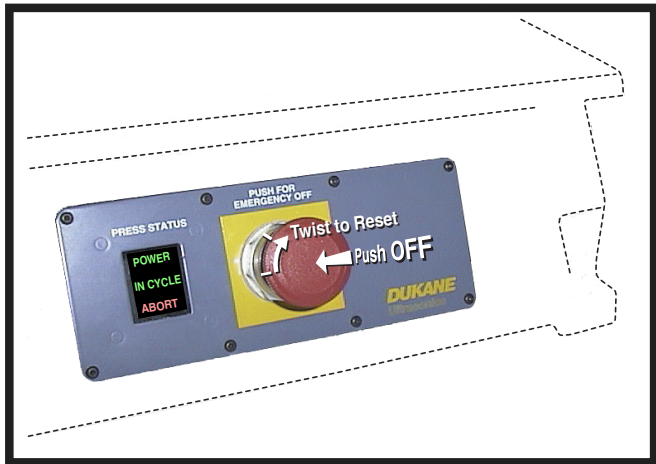


Figure 4–4 Setting and Resetting the E–Stop


## Opti-Touch Run Switches

Located on either side of the base are two optical RUN switches. These are shown in Figure 4-3. These switches use Infrared (IR) sensors. They comply with OSHA and CE safety standards. Both switches are identical.

Each optical-touch switch has a small red LED which is dimly illuminated whenever the power is on, as shown in Figure 4-5. When the operator places their finger in the tray, the LED brightens and a second LED in the opposite corner of the tray illuminates to indicate the switch has been activated as shown in Figure 4-6. Both switches must be activated simultaneously to initiate a weld cycle.




**Figure 4-5** Right Operate Switch in Standby Mode, One LED Dimly Lit

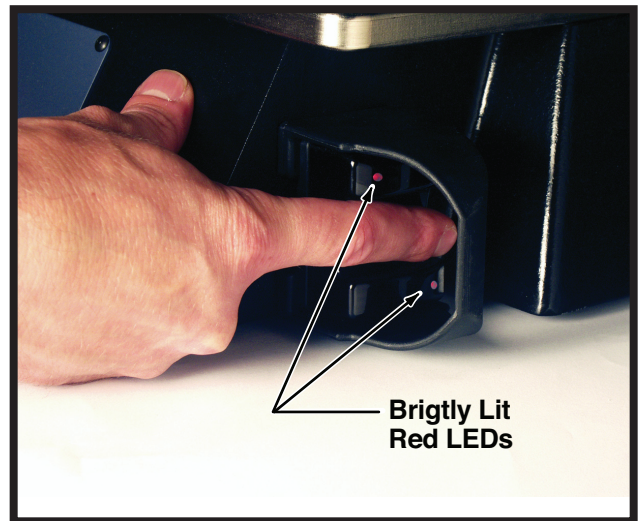

**Figure 4-6** Right Switch in Operate Mode, Both LEDs Brightly Lit

## Data I/O Connector

A connector for output data is provided on the rear of the welder above the power switch. This connector is a female type DB-9 as shown in Figure 4-7. It provides a computer connection to export part data, motor load and position profiles. A pinout of the Data I/O connector is provided in Appendix A. Detailed information on the data that can be obtained from the welder is given in Chapter 8.

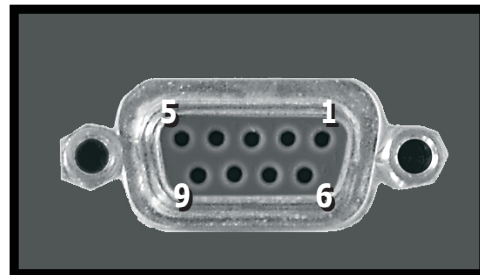

**Figure 4-7** DB-9 Data I/O Connector

*This page intentionally left blank*

# SECTION 5

## Touch Screen Menus

---

RUN Mode.....	29
Screen Layout.....	29
VIEW PARTS.....	30
SETUP Menu.....	31
PRE-WELD Setup.....	31
WELD Setup .....	34
POST-WELD Setup.....	38
TOOLS Menu .....	42
SELECT SETUP Tab.....	42
UTILITIES Tab.....	42
SYSTEM SETUP Tab.....	43
Setting Time and Date .....	46
Parameter Value Range .....	47

*This page intentionally left blank*

# RUN Mode

When the welder is first turned on after the E-Stop switch is reset (see Figure 4-4), the **STARTUP** screen is displayed as shown in Figure 5-1 directing the operator to *Activate both RUN SWITCHES to reset machine.* Press both switches simultaneously and hold until a beep sounds, which will take several seconds. A second beep will sound a few seconds after the first, indicating that the welder is ready to run a weld cycle (the bar under the smiley face will become green at the same time). The message area is now clear and the **STATUS** icon in the upper left has changed to a smiley face with a green band below it as shown in Figure 5-2. If, when the switches are activated as described above, the tooling hub begins to oscillate instead of rotating smoothly, press the E-Stop and then check that the correct tooling inertia is entered as described later in this manual in the **SETUP** Menu (under **TOOL SETUP**).

## Screen Layout

The screen has the same basic layout for most of the selected operations. The **STATUS** icon indicates the ready state of the machine. To the right of the icon is the name of the currently loaded Setup File. Below the file name is the Message Area. The three mode select buttons on the left side below the status icon select either a Run mode (**RUN**), a Weld Setup screen (**SETUP**), or the Setup Utilities screen (**TOOLS**). The selected mode is indicated by a darkened button. The center of the screen displays the parameters from the last weld cycle. The **Part Data** button on the right displays a report of previously welded parts.

The screen shots on this page all show the **RUN** mode. The **RUN** screen is the default startup screen. This screen needs to be selected in order to initiate a weld cycle. Just below the **PROCESS DATA** label as shown in Figure 5-2, there are a number of fields containing part data. The **Part Nr.** field identifies the current sequential part number. The **Limits** field indicates if the last weld was within programmed process limits and displays “-” if no limits were violated, “S” for suspect part, “B” for a bad part, or “E” for an error. A suspect or

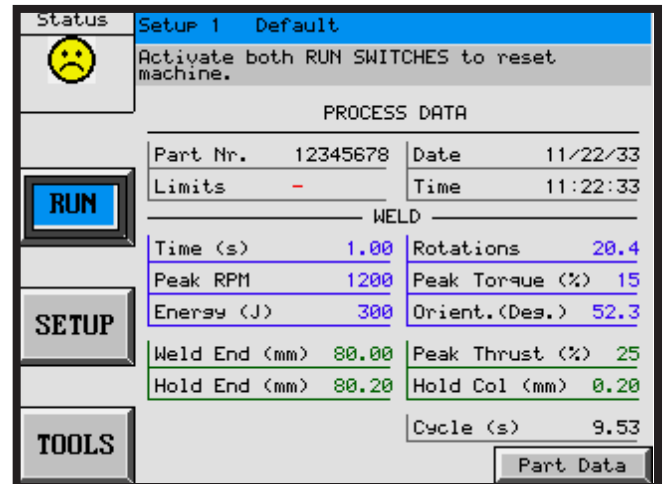


Figure 5-1 Startup Screen With E-Stop Cleared

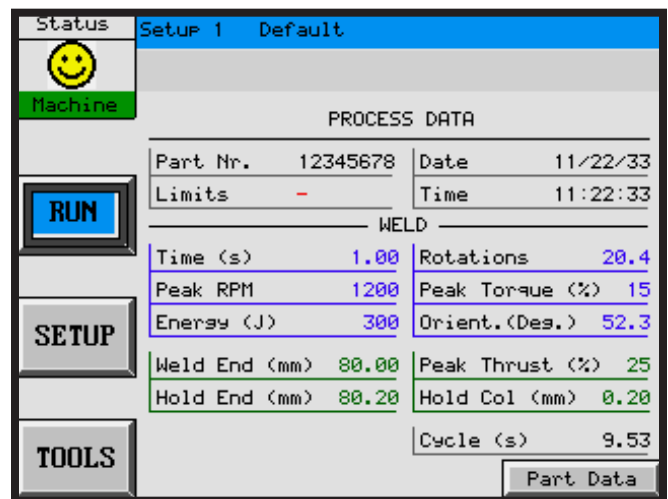


Figure 5-2 Run Mode Screen With Welder Reset

bad part means one or more of the measured parameters was not within the limits set for the weld cycle. The Time and Date fields indicate the time and date the part was welded.

Just below the WELD label, there are a number of fields with weld data for the last cycle. The displayed data lists the:

- Time - Weld time (seconds)
- Rotations - Number of spin motor rotations during weld
- Peak RPM - Peak spin motor speed (RPM)
- Peak Torque - Peak spin motor torque (% of maximum torque)
- Energy - Weld energy (Joules)
- Orient. - Welded part angular orientation (degrees)
- Weld End - Weld end vertical position (mm)
- Peak Thrust - Peak vertical actuator thrust (% of maximum thrust)
- Hold End - Hold end vertical position (mm)
- Hold Col - Hold collapse distance (mm)
- Cycle - Total cycle time (seconds)

## VIEW PARTS

The Part Data button on the right side of the screen displays seven part reports at a time. Each report occupies two lines and displays the same information reported on the RUN screen. The report starts with the last cycle at the bottom and works backwards toward the top. This is shown in Figure 5–3. The Page Up and Page Down buttons permit you to scroll through part data one screen at a time, Press the RUN button to return to the RUN screen.

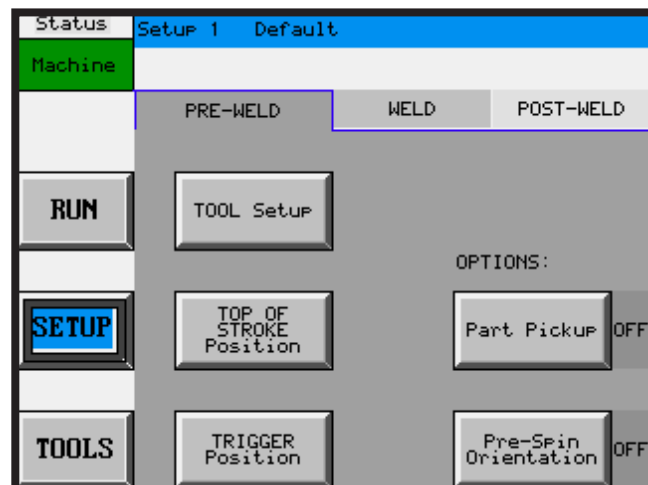


Figure 5–3 VIEW PARTS Screen



# SETUP Menu

The SETUP menu is sub-divided into three tabs: PRE-WELD, WELD, and POST-WELD that are described below. Immediately after pressing the SETUP button, the Security Code screen will appear, prompting for a numerical password. If no password has been set, press the ENTER key.

## PRE-WELD Setup

The PRE-WELD screen, containing a number of settings and options described below, is shown in Figure 5-4.

### TOOL Setup

This button is used to specify parameters related to the tooling assembled to the welder shown in Figure 5-5. Enter the spin tool inertia in the TOOL Inertia ( $\text{kg}\cdot\text{cm}^2$ ) field and the weight in the TOOL Weight (kg) field. Pressing the numerical value cell displays a data entry screen shown in Figure 5-6. That also displays the minimum and maximum values allowed. The SPIN Deceleration (%) field specifies the spin motor deceleration as a percentage of motor maximum. This value can exceed 100% when welding parts because friction in the weld joint assists the spin motor in stopping.

The Vac. Sense and Part Present buttons at the bottom allow the vacuum sensing and part presence options to be enabled or disabled. With either option enabled, an appropriate external input must be provided. For example, if the Part Present option is enabled, a part present signal must be activated before a weld cycle is allowed to initiate. A “frowning” face will be displayed on the RUN screen if this signal is not active.

Press the DONE button to return to the PRE-WELD setup screen.

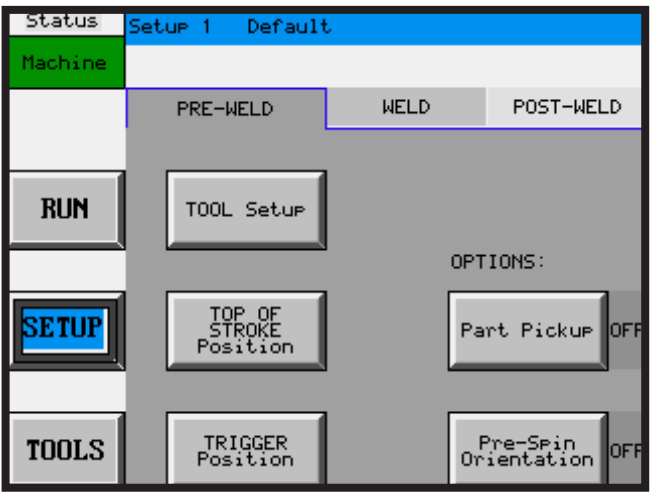


Figure 5-4 PRE-WELD Screen for SETUP Menu

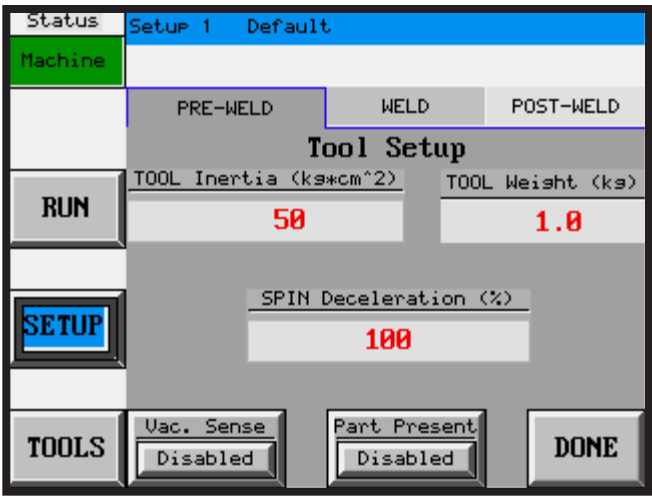


Figure 5-5 Tool Setup Screen in PRE-WELD Menu



Figure 5-6 Sample Data Entry Screen

TOP OF STROKE Position

This button is used to set the vertical position to which the welder head returns after completing a weld cycle, as shown in Figure 5-7. A position of 0 corresponds to the highest position (which is also the machine “home” position). A non-zero setting indicates that the Top of Stroke (TOS) position is lower than the home position by the programmed amount. The TOS position can be entered directly by pressing the Position (mm) field. Alternatively, the TOS position can be “taught” by first pressing the DOWN button and selecting the VERT. Jog Speed (Low, Medium, or High), then activating the RUN switches to jog the head to the desired position, and finally pressing the Transfer button to assign the current jog position (displayed in the Jog Pos. (mm) field) as the TOS Position.

The Move To button is used to move the head to the value displayed in the Position (mm) field. After pressing this button, activate both RUN switches and wait for the value in the Jog Pos. (mm) field to match the Position (mm) value.

TRIGGER Position

This button is used to set the vertical position at which the spin tool and machine head reach the programmed weld speeds, as shown in Figure 5-8. If Torque Triggering is disabled (see below), the weld starts at the TRIGGER Position. This position should be set slightly higher than the position at which the parts to be welded start to come in contact. Above this position, the spin motor is being accelerated from rest to the weld RPM and the head is moving rapidly down. After reaching this position, the spin RPM and vertical speeds are maintained at the programmed values. The TRIGGER Position can be entered directly into the Position (mm) field or taught by jogging the head as described in setting the TOP OF STROKE Position.

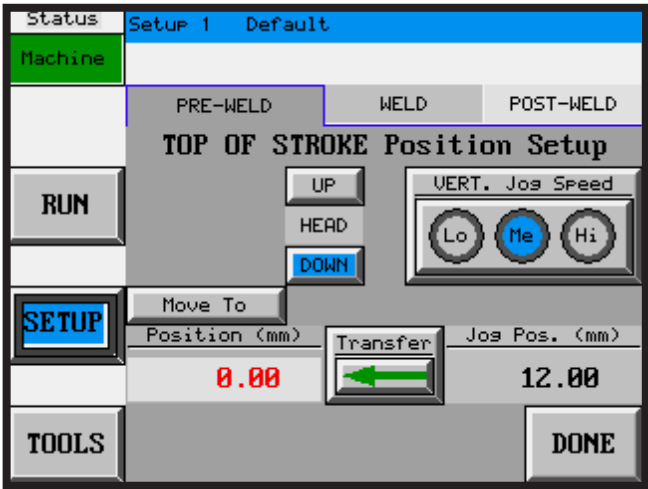


Figure 5-7 TOP OF STROKE Position Setup Screen in PRE-WELD Menu

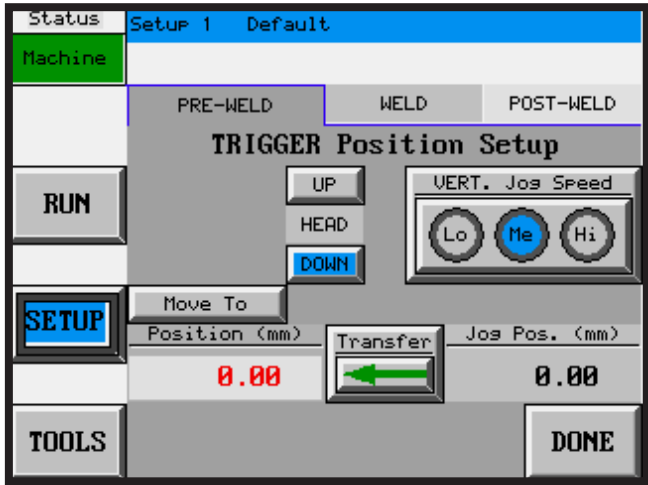


Figure 5-8 TRIGGER Position Setup Screen in PRE-WELD Menu

## Part Pickup Option

This button enables the Part Pickup option, which is programmed through the screen shown in Figure 5-9. This option is used in conjunction with automated part feed systems where it is desirable to place the parts to be joined on top of each other in the lower fixture. In this mode, the head travels down to “pick up” the upper part with the tool (without spinning), goes up slightly, and then completes the weld cycle. To enable this option, toggle the Enable button to On and set the pickup position in the Position (mm) field by direct entry or through the Teach Position button. Optionally, the Thrust Sense option can be enabled, in which the head will first travel to the Position (mm) distance, then continue to travel until the vertical actuator thrust (i.e. force) exceeds the value set in the Thrust (%) field. The Timeout (s) field sets a time limit between the arrival at the Position (mm) distance and the point of reaching the thrust sensing level.

## Pre-Spin Orientation Option

This button enables the Pre-Spin Orientation option, which is programmed through the screen shown in Figure 5-10. This option is used in conjunction with the Part Pickup option in applications where, before welding, the parts are placed on top of the other and the initial (pre-spin) angular orientation is different than the welded orientation. To enable this option, toggle the Enable button to On. The Pre-Spin Orientation can be entered directly in the Pre-Spin field. Alternatively, this orientation can be “taught” by first pressing the JOG + or JOG – buttons (depending on desired direction of rotation) and selecting the jogging speed from the SPIN Jog Speed (Low, Medium, or High) field, then activating both RUN switches to rotate the spin tool to the desired orientation, and pressing the Transfer button to assign the current jog position (displayed in the Jog Pos. (Deg.) field) as the Pre-Spin Orientation. To aid in setting the orientation, the head can be moved by pressing the DOWN or UP buttons and activating the RUN switches.

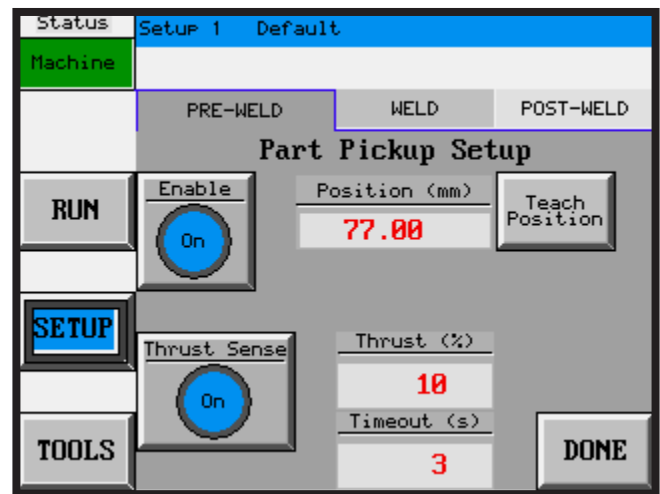


Figure 5-9 Part Pickup Setup Screen in PRE-WELD Menu

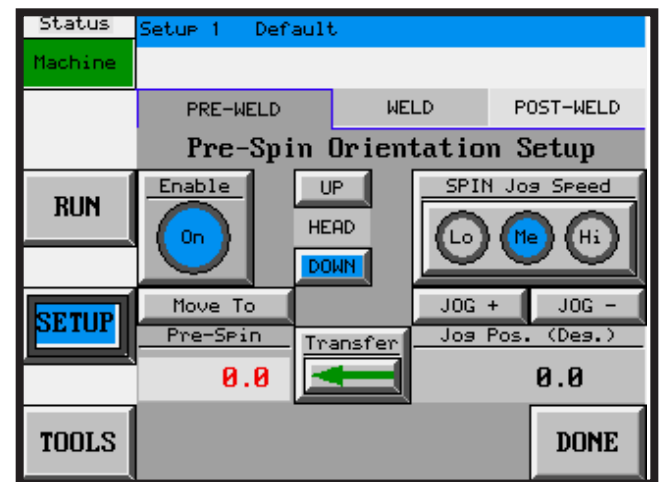


Figure 5-10 Pre-Spin Orientation Setup Screen in PRE-WELD Menu

### Transfer Button ←

The transfer icon should only be used when visually aligning the pre-spin orientation. The value displayed in the **Jog (Deg.)** cell has to be transferred to the **Pre-Spin** data field.



### IMPORTANT

You must select the RUN mode to test any of the setups. Both RUN switches must then be activated simultaneously.

The Move To button is used to rotate the tool to the value displayed in the Position (Deg.) field. After pressing this button, activate both RUN switches and wait for the value in the Jog Pos. (Deg.) field to match the Position (Deg.) value

## WELD Setup

The WELD setup is the middle tab in the SETUP menu and is shown in Figure 5-11. This screen contains the weld METHOD selection (Time, Rotation, Distance, and Energy), a button for entering Weld Parameters, and settings for several OPTIONS related to the weld phase (Orientation, Torque Trigger, and Constant Torque).

### Weld Method Selection

One of the available modes must be selected to perform a weld. Regardless of the method, the weld is considered to start at different points, depending on the Torque Trigger option setting. If Torque Trigger is OFF, the weld starts at the Trigger Position defined in the PRE-WELD tab. If Torque Trigger is ON, the weld starts when the desired spin torque threshold is exceeded (see Torque Trigger Option below).

### Time Method

In this method, the weld duration is controlled by time. After choosing this method, the Weld Parameters button is used to enter the weld settings shown in Figure 5-12. The Weld Time (s) entry specifies the weld duration in seconds. Below this entry, a minimum weld time value is displayed. This value corresponds to the time needed for decelerating (i.e., slowing down and stopping) the servo motors and is included as part of the total weld time. The VERT. Speed (mm/s) sets the press weld speed in millimeters per second. The SPIN RPM specifies the spin tool speed, which is constant during the weld until the start of deceleration. The Dir. field specifies the spin direction. The DONE button causes a return to the main WELD tab screen.

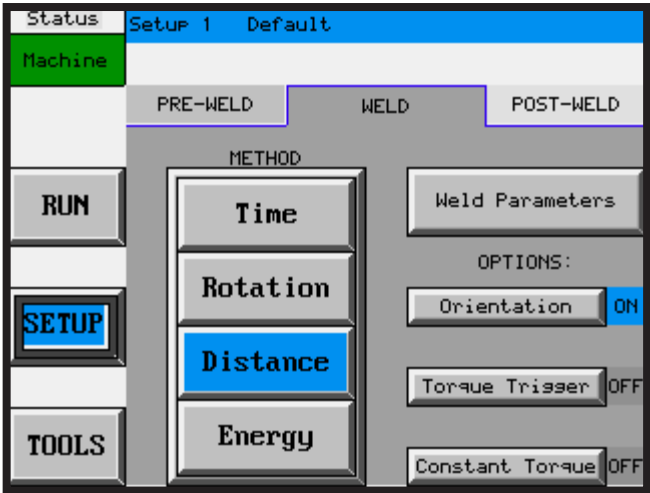


Figure 5-11 WELD Main Setup Screen

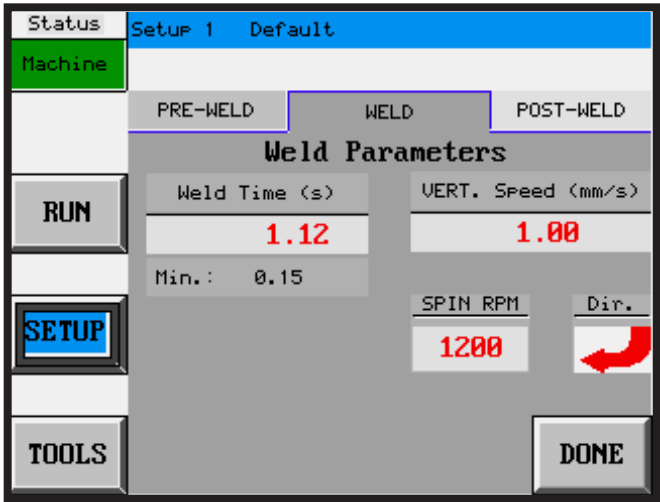


Figure 5-12 Weld Parameters Screen for Time Method

## Rotation Method

In this method, the weld duration is controlled by completing a specified number of spin revolutions. The Weld Parameters button is used to enter the settings shown in Figure 5-13. The Weld Rotations field specifies the number of weld revolutions. The actual number of weld rotations as reported on the RUN screen after the weld will be larger than the number entered in this field and depends on the deceleration and whether final orientation is enabled (see Orientation Option below). The VERT Speed (mm/s), SPIN RPM, and Dir. fields are the same as in the Time Method. The DONE button causes a return to the main WELD tab screen.

## Distance Method

In this method, the weld duration is controlled by vertical travel to a specified absolute or collapse distance. The Weld Parameters button is used to enter the settings shown in Figure 5-14. The Vertical (mm) field specifies the travel distance, depending on the position of the Collapse / Absolute switch located on the bottom of the screen. If the switch selection is Collapse as shown in Figure 5-14, the travel distance is measured relative to the trigger point. If the switch selection is Absolute as shown in Figure 5-15, the travel distance is measured from the press topmost, or 0 position (also referred to as the “home” position). The Teach Position button is available in the Absolute Distance mode, which allows the position to be defined by physically jogging the press down to the desired weld end position. The layout of the Teach Position screen is very similar to the TRIGGER Position screen shown in Figure 5-8. Directly below the Vertical (mm) field is the minimum weld distance, which is automatically calculated by the welder based on other parameters such as speed and deceleration. The VERT Speed (mm/s), SPIN RPM, and Dir. fields are the same as in the Time Method. The DONE button causes a return to the main WELD tab screen.

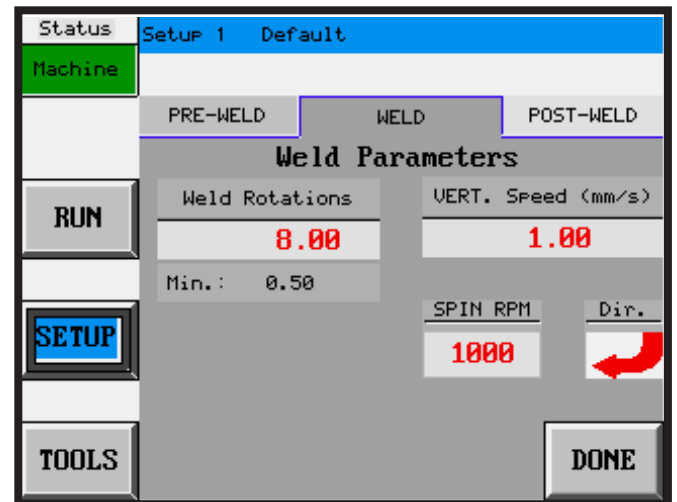


Figure 5-13 Weld Parameters Screen for Rotation Method

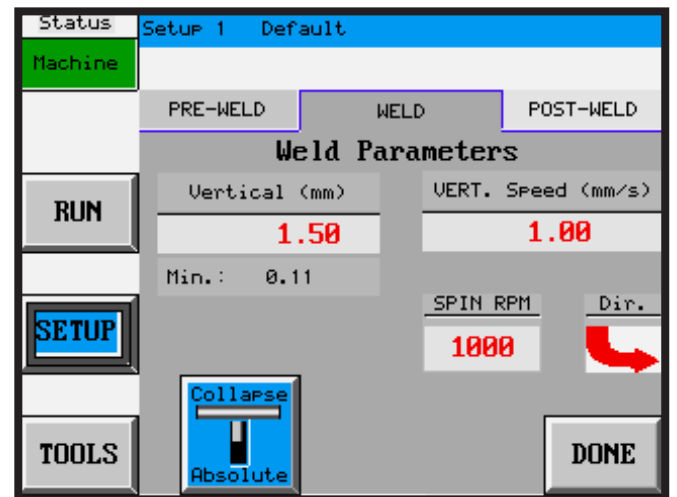


Figure 5-14 Weld Parameters Screen for Distance Method with Collapse Switch Selection

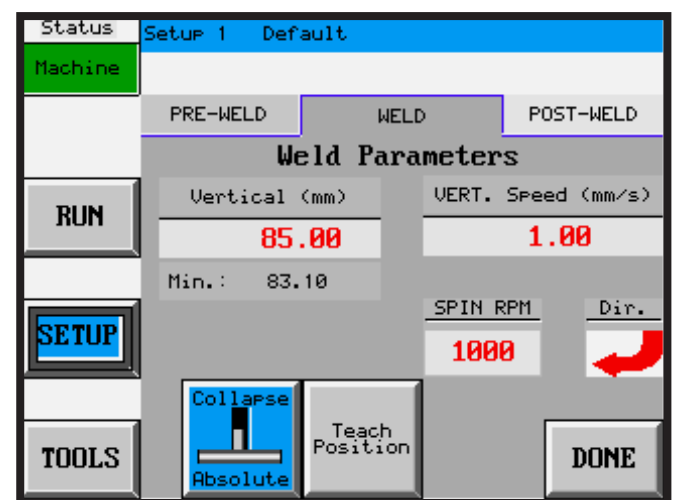


Figure 5-15 Weld Parameters Screen for Distance Method with Absolute Switch Selection

## Energy Method

In this method, the weld duration is controlled by the amount of energy input into the weld joint as determined by the spin torque and angular rotation. The welder will maintain a constant spin speed until the programmed energy is produced, at which point the tool will decelerate and stop. The Weld Parameters button is used to enter the settings shown in Figure 5-16. The Energy (J) field specifies the weld energy in Joules. As a safety measure, the use of the Energy Method requires that the Weld Time Process Limit be enabled (refer to the Process Limits description in the POST-WELD menu later in this manual on how to set this limit). If the Upper Weld Time Limit is exceeded during the weld, the machine will stop the cycle and report an error. The VERT Speed (mm/s), SPIN RPM, and Dir. fields are the same as in the Time Method. The DONE button causes a return to the main WELD tab screen.

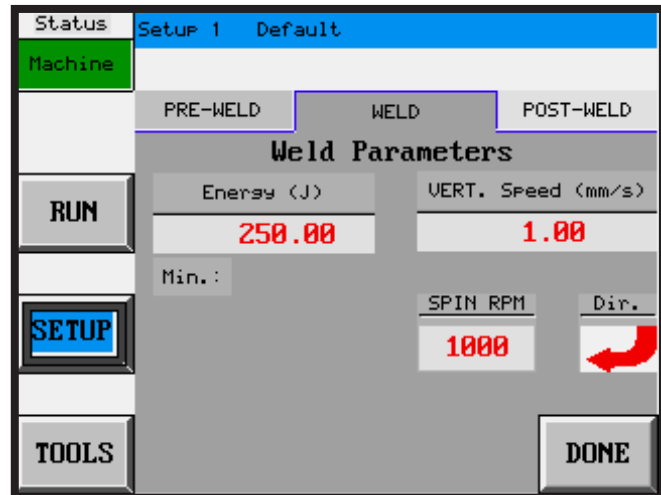


Figure 5-16 Weld Parameters Screen for Energy Method

## WELD OPTIONS

Several weld options are available, any combination of which may be enabled simultaneously.

### Orientation Option

This option is used to specify the angular stopping orientation of the upper tool at the end of the weld. To enable it, press the Orientation button and then the Enable box on the screen shown in Figure 5-17. The final weld orientation is defined in the Weld field. There are two methods for setting this value: 1) direct numeric entry into the Weld field, or 2) visual alignment by jogging the spin tool to the desired orientation. To jog the spin tool, first select the SPIN Jog Speed (Low, Medium, or High) and the jog direction (JOG + or JOG -), then activate both RUN switches to rotate the tool. The current spin tool orientation is displayed in the Jog Pos. (Deg.) box. Once the head is in the desired orientation, the Transfer arrow button is used to set this value as the final Weld orientation. To aid in visually setting the orientation, the press can be jogged vertically by selecting the DOWN or UP buttons and activating both RUN switches. The Move To button allows the spin tool to be rotated to the programmed Weld orientation. After selecting this button, activate both RUN switches until the spin tool

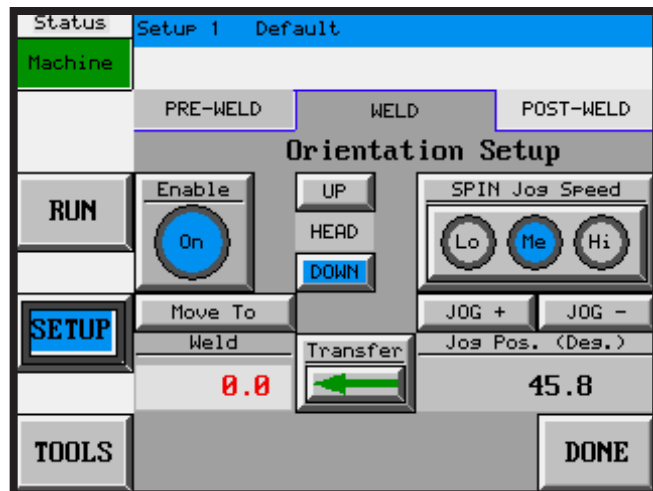


Figure 5-17 Weld Orientation Option Screen



stops moving. The DONE button causes a return to the main WELD tab screen.

## Torque Trigger Option

This option specifies a torque level to sense when the upper and lower parts make contact. Prior to contact, the motor is spinning the tool in the air using a very low amount torque. At contact, there is an increase in the torque required to maintain a constant angular velocity, at which point the weld is considered to start (i.e. the weld timer and counter are started). Note that the welder begins to sense the torque after reaching the TRIGGER Position. To enable this option, press the Torque Trigger button and then the Enable box on the screen shown in Figure 5-18. The Torque (% of max.) field specifies the torque level at which the weld will start. The Timeout (s) value specifies the amount of time the welder will wait between reaching the TRIGGER Position and the sensing of the torque trigger. If torque trigger does not occur within this time, the machine will abort the cycle and display an error. The DONE button causes a return to the main WELD tab screen.

For this option to work properly, the torque trigger value must be set above the torque required to keep the spin tool running before part contact (i.e. in free air). To set the torque trigger value correctly, follow these steps:

1. Program all welder settings as desired (refer to other sections in this manual if needed).
2. Disable the Torque Trigger Option.
3. Verify that the VERTICAL TRAVEL LOWER LIMIT is set properly to prevent the possibility of contact between the tool and fixture (refer to TOOLS, SYSTEM SETUP tab menu).
4. Press the RUN button.
5. Run a “dry” cycle (i.e. without parts) by activating both RUN switches until the spin motor stops.
6. Read the Peak Torque (%) value on the RUN screen. This value represents the torque required to keep the tool spinning in the air.
7. Enable the Torque Trigger Option and set the Torque (% of max.) field to be slightly larger (at least 2%) than the number from the previous step.

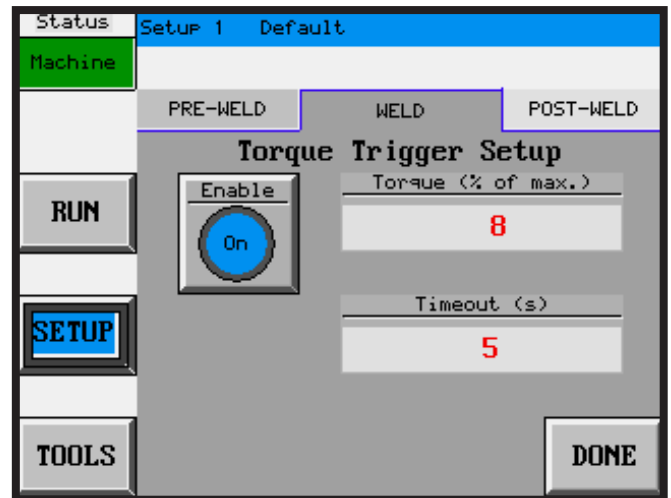


Figure 5-18 Weld Torque Trigger Option Screen

## Constant Torque Option

This option sets the welder to function in “Melt-Match” mode, in which the press vertical speed is continuously adjusted to match the rate of plastic melt at the joint. This is achieved by measuring the spin torque and changing the vertical speed on-the-fly based on this measurement. The vertical speed is inversely proportional to the spin torque: the lower the spin torque, the higher the vertical speed, and vice versa.

To enable this option, press the Constant Torque button and then the Enable box on the screen shown in Figure 5-19. The relationship between the spin torque and vertical speed is illustrated in Figure 5-20. The welder will adjust vertical speed for a measured spin torque along the lines shown. The Torque Target is the desired spin torque, which is entered into the Torque (% of max.) field on the screen. The Max. Torque value is 5% larger than the Target Torque. If the measured torque exceeds the Max. Torque, the vertical speed will be 0 until the torque drops below the maximum. The Max. Speed is the maximum allowable vertical speed, which will occur if the measured torque is 0. This value is entered in the VERT. Max (mm/s) field on the Weld Parameters screen (in the WELD tab). The Timeout (s) field specifies the maximum weld time before the machine aborts the cycle and reports an error.

The actual spin torque profile achieved during the weld will depend on the Torque (% of max.) and the VERT. Max (mm/s) settings for a particular application. For example, if the actual spin torque is consistently below the specified target, the VERT. Max (mm/s) will need to be increased to cause the welder to move down faster, causing a rise in the spin torque.

## POST-WELD Setup

The POST-WELD setup is the right tab in the SETUP menu and is shown in Figure 5-21. The screen is divided into two sections: Hold Setup and Part Tests.

### Hold Setup

The Hold Setup button is used to enter parameters related to the Hold phase of the weld cycle. During this phase, the molten plastic cools and solidifies, beginning when the spin tool stops. Pressing the Hold Setup button

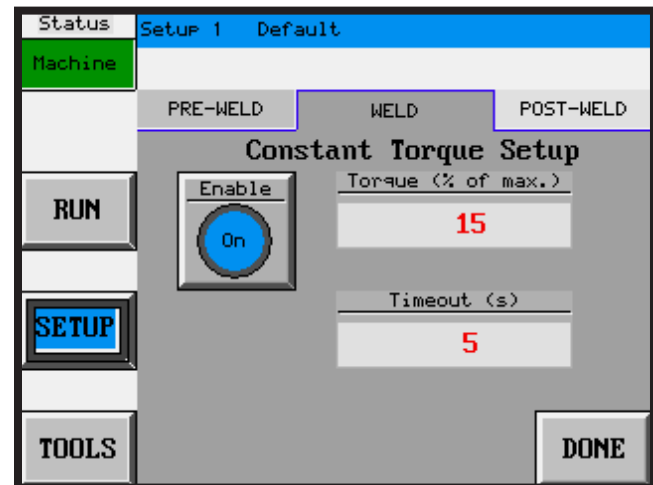


Figure 5-19 Weld Constant Torque Option Screen

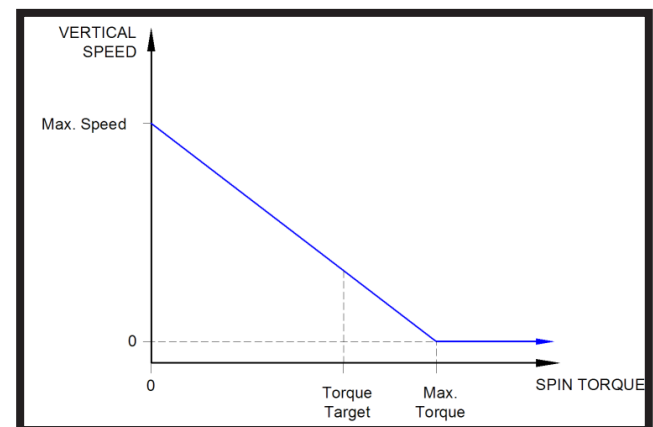


Figure 5-20 Graph of Vertical Spin Speed vs. Spin Torque for Constant Torque Option

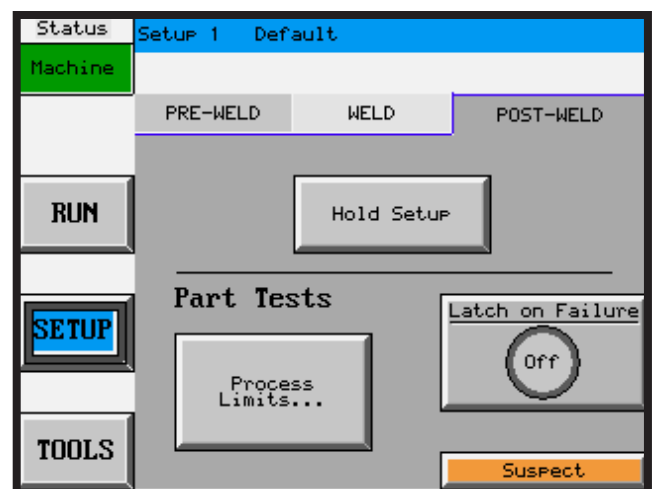


Figure 5-21 POST-WELD Main Setup Screen



changes the display to the screen shown in Figure 5-22. The MODE switch specifies if the Hold phase will be controlled by traveling a specified Distance or for a specified amount of Time.

With Distance MODE selected as shown in Figure 5-22, the parameters for Hold motion are specified in the fields on the right and are divided into two sections: DYNAMIC and STATIC. During the Hold, the press will first complete the DYNAMIC phase, then the STATIC phase. In the DYNAMIC phase, the press moves vertically at the speed specified in Speed (mm/s) to a distance specified in Collapse (mm). In the STATIC phase, the press will maintain its position for the time specified in Dwell Time(s). It is possible to bypass either the DYNAMIC or STATIC phases by programming a 0 collapse distance or a 0 dwell time, respectively.

With Time MODE selected as shown in Figure 5-23, the parameters for specifying the hold time are vertical speed in Speed (mm/s), the motion duration in Move Time (s), and time for maintaining the final position in Dwell Time (s). In addition, the Constant Thrust option is available in the Time MODE, in which the press travels down until reaching a specified vertical thrust (i.e. compression force). To enable this option, press the Constant Thrust button. The relationship between the vertical torque and vertical speed is illustrated in Figure 5-24. The press will adjust vertical speed as a response to the measured vertical thrust along the lines on the graph. The Thrust Target is the desired vertical thrust, which is entered into the Thrust (%) field on the screen. The Max. Speed is the maximum allowable vertical speed, which will occur if the measured thrust is 0. This value is entered in the Speed (mm/s) field in the DYNAMIC section.

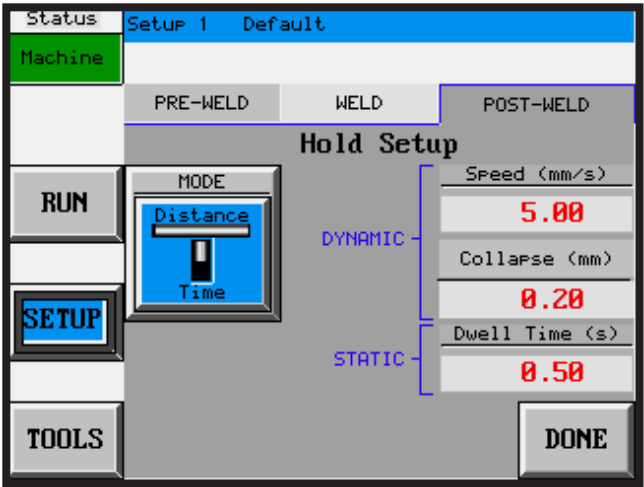


Figure 5-22 Hold Setup Screen for Distance MODE

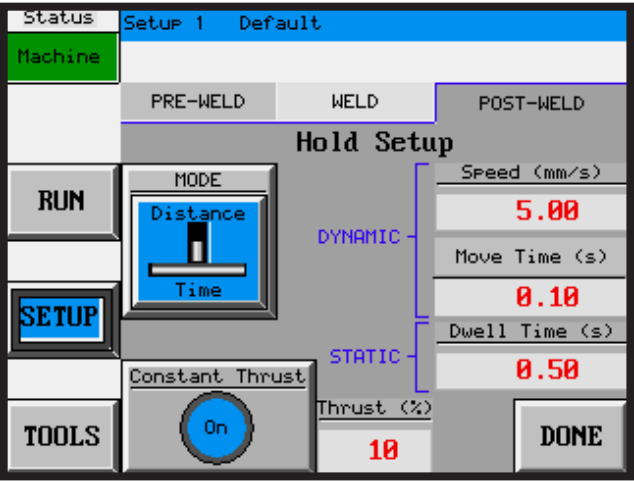


Figure 5-23 Hold Setup Screen for Time MODE

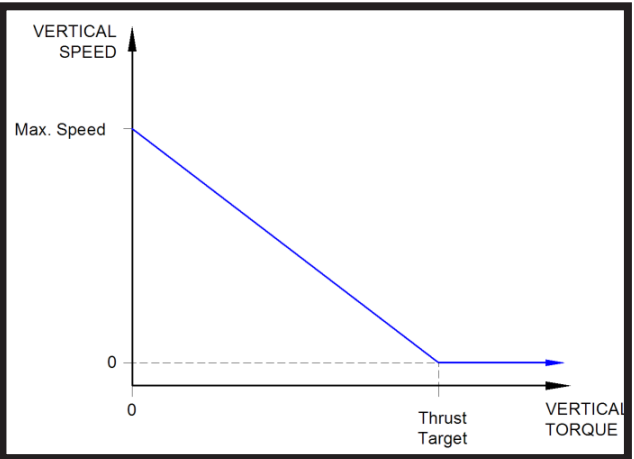


Figure 5-24 Graph of Vertical Speed vs. Vertical Torque for Constant Thrust Option

## Part Tests

The Part Tests section is used to define limits for the weld process and welder behavior for cases where the process is outside the limits.

The Process Limits button is used to enter limits for weld process results as shown in Figures 5-25, 5-26, and 5-27. The following limits are available:

1. Weld Time (s)
2. Weld Rotations
3. Orientation (Deg.)
4. Weld Energy (J)
5. Peak RPM
6. Peak Torque (% of max.)
7. Peak Thrust (% of max.)
8. Cycle Time (s)
9. Vertical Weld End (mm)
10. Hold Collapse (mm)
11. Hold End Position (mm)

To enable a limit, press the ON/OFF box to the left of the description and enter the Lower and Upper values. Any combination of limits can be enabled simultaneously. The More Limits... button shows additional limits, and the DONE button causes the screen to return to the POST-WELD main menu.

Machine	PRE-WELD	WELD	POST-WELD
<b>Distance Method Limits</b>			
<input checked="" type="checkbox"/> On	Weld Time (s)	2.00	2.50
<input checked="" type="checkbox"/> On	Weld Rotations	13.00	17.00
<input type="checkbox"/> Off	Orientation (Deg.)		
<input type="checkbox"/> Off	Weld Energy (J)		
<input type="button" value="More Limits..."/>		<input type="button" value="DONE"/>	

Figure 5-25 Process Limit Definitions Screen 1 of 3

Machine	PRE-WELD	WELD	POST-WELD
<b>Distance Method Limits</b>			
<input type="checkbox"/> Off	Peak RPM		
<input checked="" type="checkbox"/> On	Peak Torque (% of max.)	20	25
<input type="checkbox"/> Off	Peak Thrust (% of max.)		
<input type="checkbox"/> Off	Cycle Time (s)		
<input type="button" value="More Limits..."/>		<input type="button" value="DONE"/>	

Figure 5-26 Process Limit Definitions Screen 2 of 3

Machine	PRE-WELD	WELD	POST-WELD
<b>Distance Method Limits</b>			
<input type="checkbox"/> Off	Vertical Weld End (mm)		
<input type="checkbox"/> Off	Hold Collapse (mm)		
<input checked="" type="checkbox"/> On	Hold End Position (mm)	85.10	85.30
<input type="button" value="DONE"/>			


Figure 5-27 Process Limit Definitions Screen 3 of 3

The bottom right corner of the POST-WELD screen contains controls for setting machine behavior when an out-of-limit condition occurs. The Latch on Failure button specifies if the out-of-limit condition will require an acknowledgement from the user before allowing the next cycle to start. This acknowledgement request is indicated by a button on the bottom of the RUN screen as shown in Figure 5-28.

The Suspect / Bad (Abort) button in the right lower corner of the screen controls two aspects of machine function. The first function is to determine if a weld cycle will be aborted if the process parameter falls outside the limits. If Suspect is selected, the machine cycle will complete regardless of the process limit results. If Bad (Abort) is chosen, the machine cycle will continue if any process parameter falls below the Lower limit, or be terminated if it exceeds the Upper limit for the following parameters:

- Weld Time (s)
- Weld Rotations
- Peak RPM
- Peak Torque (% of max.)
- Peak Thrust (% of max.)
- Cycle Time (s)

In the case of cycle termination, the machine will report an error message on the RUN screen listing the parameter for which the limit was exceeded. The second function is to set the character displayed in the Limits field on the RUN screen. If the switch is set to Suspect, the Limits field will display S if the process was outside the limits. If it is set to Bad (Abort), the Limits field will display B if the process parameter was lower than the Lower limit, and E if the process parameter was higher than the Upper limit.

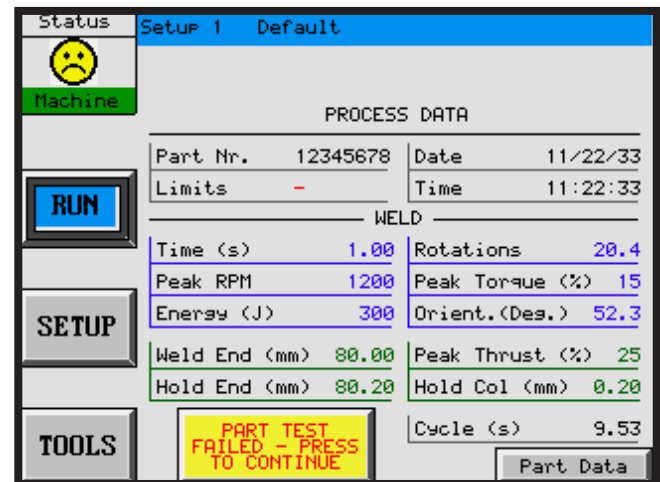

**Figure 5-28** RUN Screen with PART TEST FAILED Button

# TOOLS Menu

## SELECT SETUP Tab

Pressing the TOOLS button displays the first tab labeled SELECT SETUP. This contains eight buttons for selecting a setup file as shown in Figure 5–29. The Machine Cycle Count in the lower right corner is the total number of weld cycles that have occurred in the machine's lifetime.

## UTILITIES Tab

The middle tab named UTILITIES and shown in Figure 5–30 contains buttons for renaming, copying, and erasing setups, as well as a button for accessing a screen to record other machine settings and one for exporting the graph data for the last weld.

Rename Setup allows a name up to 26 characters. The keypad has the letters a through z and a caps key for A through Z, plus the numbers 0 through 9 and a space key. To rename a setup, enter a new name and then press the RENAME button under the new name. Press the DONE button when finished.

Copy Setup copies the values of the currently loaded setup file to the setup file specified. To copy a setup, press the Destination Setup ID button, enter the desired number, then press the COPY button. Press the DONE button when finished.

Erase Setup clears all setup parameter values and restores them to factory defaults. To erase a setup, press the ERASE button, and then the DONE button.

The OTHER MACHINE SETTINGS button is used as a “notepad” feature in recording the information shown in Figure 5-31 and is provided as a convenience feature for restoring the complete machine setup. The Upper Tool Nr. and Lower Tool Nr. fields can be populated with tool identification numbers. The Column Position (mm)

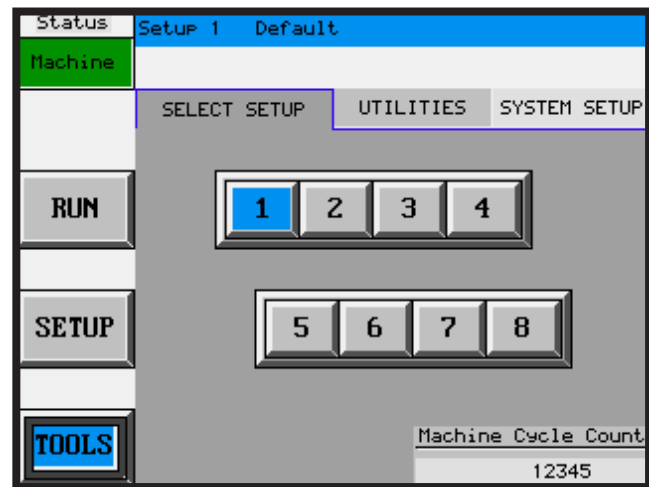


Figure 5–29 SELECT SETUP Screen in TOOLS Menu

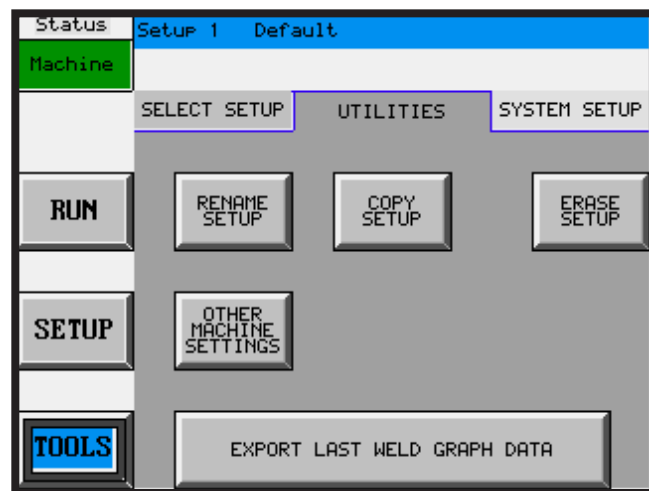


Figure 5–30 UTILITIES Screen in TOOLS Menu



Figure 5–31 Record Other Machine Settings Screen in UTILITIES Menu

field designates the position of the thruster (part of the welder surrounded by sheet metal covers) relative to the column as indicated by the scale affixed to the right side of the column and a white line printed on the rear of the welder. Once these settings are entered, pressing the DONE button causes a return to the main UTILITIES screen, where a yellow SAVE OTHER SETTINGS button appears. Press this button, then Save and DONE on the following screen to retain the settings in memory.

The EXPORT LAST WELD GRAPH DATA button is used to send weld profile data information for the last cycle to an externally connected computer via the Dual Servo Spin Welder Utility (refer to Chapter 8). This data includes the spin torque, spin orientation, vertical thrust, vertical position, and vertical speed. It is displayed in graphical format in the Utility and can be exported to an ASCII file.

## SYSTEM SETUP Tab

The third tab is labeled SYSTEM SETUP and is shown in Figure 5-32.

The welder contains an assembly used to limit the downward travel of the press to prevent tooling from coming in contact. This assembly consists of a mechanical stop block with an integral proximity switch, whose position is adjusted via an elevator screw driven by a small DC motor. If, during normal operation, the press travels down and the proximity switch becomes active, the press motion will quickly decelerate to a stop. The actual physical hard stop is approximately 4 mm below this position since the stop block includes a cushion to protect the vertical servo actuator from damaging impact loads. To set the lower limit proximity switch position, first press the VERTICAL TRAVEL LOWER LIMIT button. Then press the Initialize button shown on the screen in Figure 5-33, which will cause the stop block to move all the way down, which takes 1 minute as indicated by a flashing message. When this step is completed, the screen will change as indicated in Figure 5-34. Next, jog the head down to the desired travel limit position (at least 4 mm

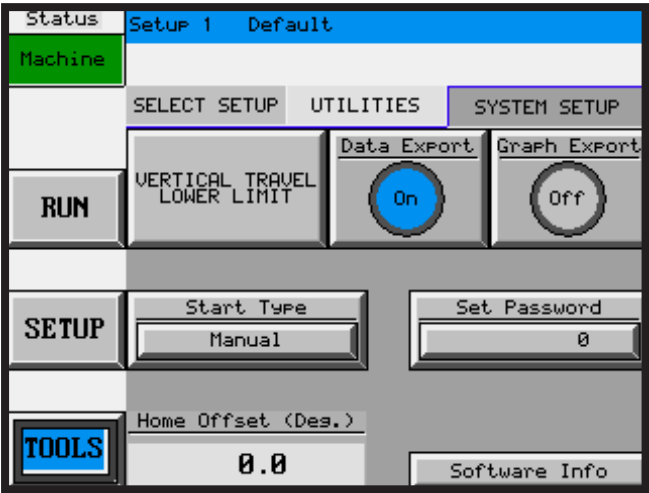


Figure 5-32 SYSTEM SETUP Tab in TOOLS

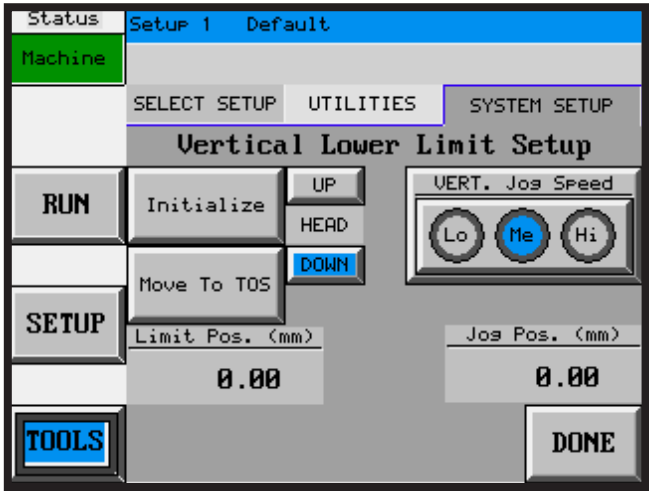



Figure 5-33 Vertical Lower Limit Setup Screen with Initialize Button

[.15 in.] above tooling contact, if possible) and press the Set Position button. The stop block will be moved up, and a flashing circle will appear next to the DOWN button when this process is complete, indicating that the proximity switch is active. Press the DONE button to return to the SYSTEM SETUP screen.

The Data Export button controls whether the weld parameter data displayed on the RUN screen (Weld Time, Rotations, etc.) is sent out to a computer connected to the welder after each cycle (refer to Chapter 8). Pressing the button toggles between On and Off states.

The Graph Export button controls whether the weld profile data captured for the last weld is sent out to a computer connected to the welder after each cycle (refer to Chapter 8). This data includes the spin torque, spin orientation, vertical thrust, vertical position, and vertical speed. It is displayed in graphical format in the Utility and can be exported to an ASCII file. Pressing the button toggles between On and Off states. The time required to transfer the data for this option can be significant (several seconds, depending on weld duration) and may adversely affect cycle rate as the welder will not be ready to run another cycle until the transfer is complete.

The Start Type button toggles from Manual to Automatic each time it is pressed. Manual is used for most operations. Automatic is used in an automated system and requires a switch closure contact on the User I/O HD-15 connector (see Figure 3-9). A pinout of the User I/O connector and automation wiring information are provided in Appendix A.

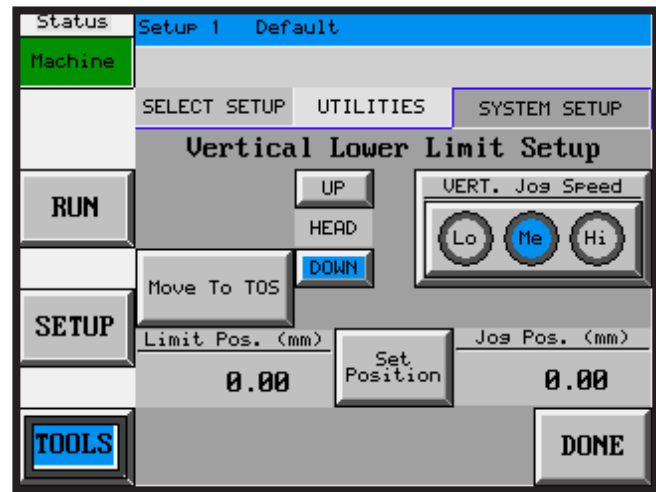

**Figure 5-34** Vertical Lower Limit Setup Screen with Set Position Button

The Home Offset (Deg.) field is used to specify an angular offset of the homing spin orientation. The tooling hub home orientation is set at the factory such that the slot in the hub shown in Figure 3-2a is closest to the front of the machine. This position is the 0 degree reference for the spin motor and all spin orientations are defined relative to it. Unless a specific situation requires a non-zero offset, it is most convenient to retain the factory default value.

The Set Password button is used to set the password, which must subsequently be entered to change programmed machine settings. The default password is 0 (zero) so that password-protected screens are easily accessed by just pressing the Enter key on the Enter Password Code screen. The password is a numerical value with a maximum 10-digit value of 4 294 967 295. The password-protected screens and menus are shown in Figure 5-35.

The Software Info button displays a screen with software revisions of the welder components as shown in Figure 5-36.

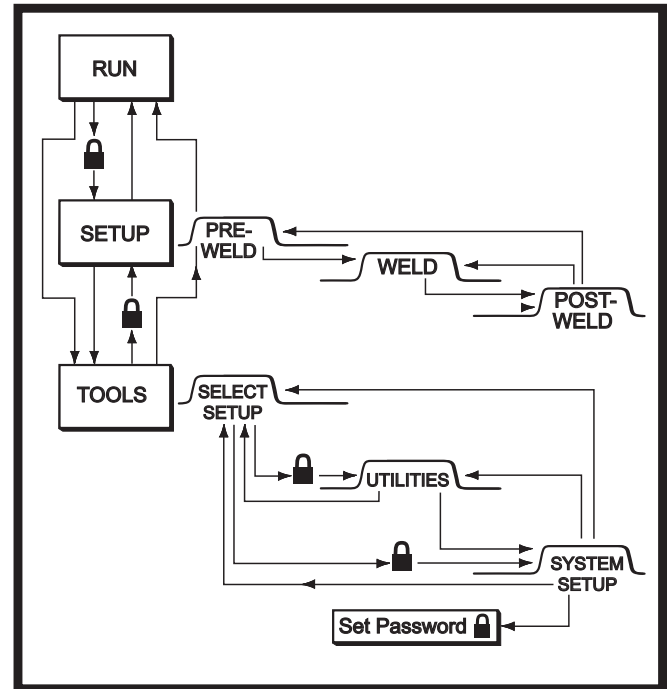


Figure 5-35 Password-Protected Screens and Menus

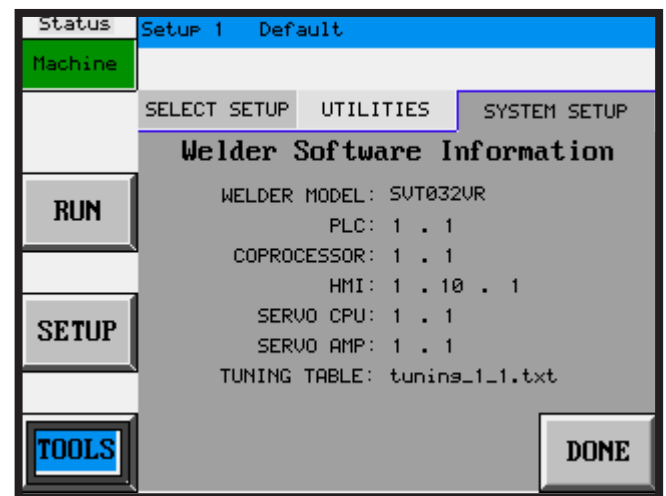


Figure 5-36 Welder Software Information



# Setting Time and Date On Touch Screen

The time and date displayed on the touch screen are preset at the factory for US Central Standard Time. They can be changed using the following procedure:

1. Press the upper left-hand corner (marked by 1 in Figure 5-37) and lower left-hand corner (marked by 2) at the same time. The screen shown in Figure 5-38 should appear.
2. Press the "Clock" button. The screen shown in Figure 5-39 should appear.
3. To change the date and time, first enter a numeric value. Then press the corresponding button associated with that value. For example, to set the month to May, press 5 and then the "Mon" button.
4. After setting the time and date, press the "Exit" button on this screen and on the next screen.
5. Wait several seconds for the touch screen to return to normal operation before welding.

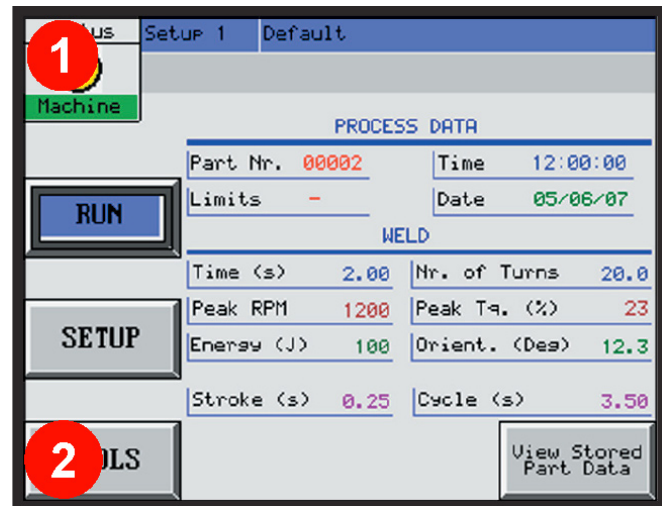


Figure 5-37 Touch Screen - Time and Date 1

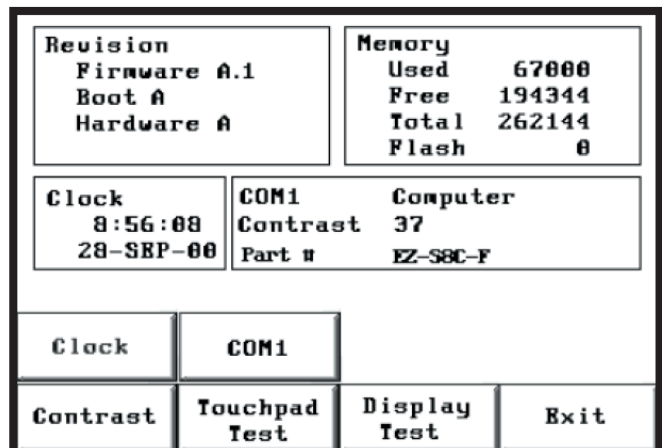


Figure 5-38 Touch Screen - Time and Date 2

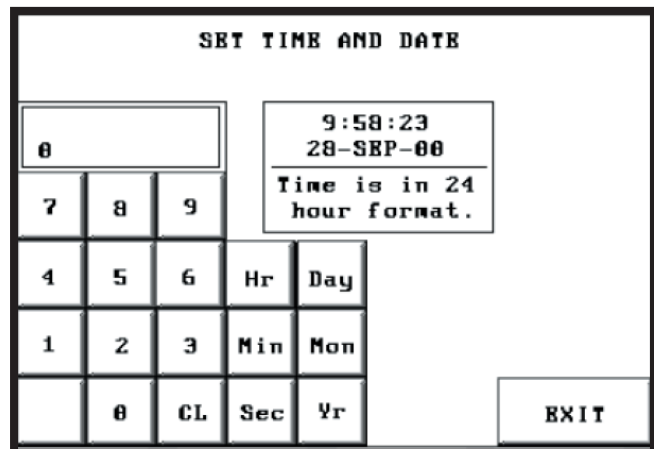


Figure 5-39 Touch Screen - Time and Date 3



# Parameter Value Range

The minimum and maximum values of the welding parameters are listed in Table 5-I.

Screen	Parameter Name	Min.Value	Max.Value	Resolution	Units
SETUP> PRE-WELD	TOOL Inertia	0	3000 (SVT012VR) 780 (SVT032VR) 160 (SVT042VR)	1	kg* cm <sup>2</sup>
	TOOL Weight	0	25.0	0.1	kg
	SPIN Decel.	25	200	1	%
	TOP OF STROKE Position	0	140.00	0.01	mm
	TRIGGER Position	1.00	140.00	0.01	mm
	Part Pickup Position	1.00	140.00	0.01	mm
	Part Pickup Thrust	1	100	1	%
	Part Pickup Timeout	1	60	1	sec.
	Pre-Spin Orientation	0	359.9	0.1	deg.
SETUP> WELD	Weld Time/ Weld Rotations/ Weld Distance (Vertical) / Energy	0.01	50000	0.01	sec./ rev./ mm/ Joules
	VERT. Speed	.01	100.00	0.01	mm/s
	SPIN RPM	5	750 (SVT012VR) 3000 (SVT032VR) 4000 (SVT042VR)	1	RPM
	Weld Orientation	0	359.9	0.1	deg.
	Trigger Torque	1	100	1	%
	Torque Trigger Timeout	1	60	1	sec.
	Constant Torque	1	100	1	%
	Constant Torque Timeout	1	60	1	sec.
SETUP> POST-WELD	Hold Speed	.01	100	0.01	mm/s
	Hold Move Time/ Hold Collapse	0	140.00	0.01	sec./ mm
	Hold Dwell Time	0	100.00	0.01	sec.
	Hold Constant Thrust	1	100	1	%
TOOLS> SYSTEM SETUP	Home Offset	0	359.9	0.1	deg

**Table 5-I** Welding Parameters

*This page intentionally left blank*

# SECTION 6

## Machine Operation

---

Machine Setup.....51

Starting a Weld Cycle .....54

Stopping a Weld Cycle .....55

Setup Sheet..... 55-56

*This page intentionally left blank*

# Machine Setup

The startup procedure given here is for a new machine that has just been installed.

## 1. Base Interface Cable

Attach the base interface cable from the rear of the base to the back of the thruster housing as shown in Figures 3-7 and 3-8.

## 2. AC Power

Insert the AC power plug (refer to Figure 3-4) into a 240 VAC, 1-Phase NEMA type 6-20R receptacle rated at 20 Amps. The correct style outlet is shown in Figure 3-5. Do not alter the plug or receptacle in any way. Refer to the section on Electrical Safety in Chapter 2 if you have any questions. Ensure the AC Power Switch is in the OFF position (see Figure 3-6).

## 3. Attach Tooling

Attach the upper tooling to the hub and torque tightly. The hub dimensions are given in Figure 3-2. The slot in the hub is intended to accept a 1/4-inch standard dowel pin assembled to the upper tool for repeatable mounting orientation. Place the lower fixture on the base and attach it loosely so it can be aligned later.

## 4. Adjust Thruster Position on Column

The rear support column of the Dual Servo Spin Welder features a threaded shaft for adjusting the overall height of the thruster head. The adjustments are shown in Figure 3-7. The thruster height should be adjusted properly to ensure that the weld head has enough travel to perform the weld (within the 5-inch stroke limit), and that the welded assembly can readily be removed from the tooling. To adjust the position, complete the following steps:

- Loosen the three rear nuts (which lock the head assembly in place). The nuts are 22mm wide, but a 7/8-inch socket will also fit.
- Raise or lower the head by turning the adjustment lead screw on top, which is also a 22mm hex. The lead screw has 8 threads per inch, so 1 turn moves the head 1/8-inch (3.18 mm).
- Tighten the rear locking nuts.

### IMPORTANT



The Dual Servo Spin Welder is capable of developing substantial torque and high rotational velocity. Keep your hands and body away from the tool head during operation. The spinning head is capable of inflicting serious injury. Never attempt to retrieve a part from a spinning tool head. Always wear a face shield when operating the Dual Servo Spin Welder. Be extremely careful not to let long sleeves, necklaces or long hair become entangled in the Dual Servo Spin Welder during operation.

Always turn machine power OFF when installing or removing the spin tool.

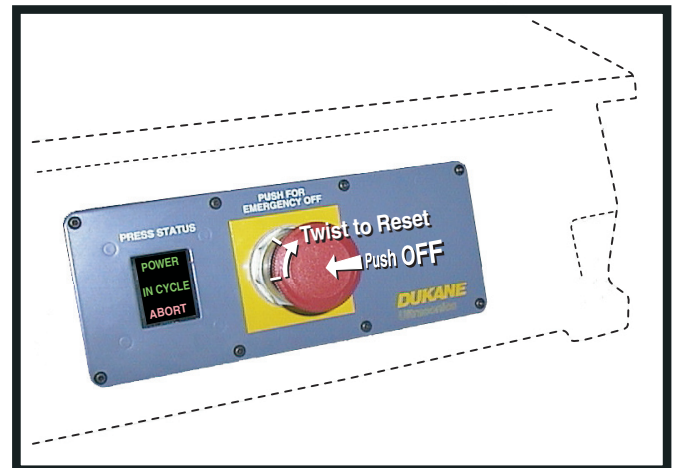


Figure 6-1 Setting and Resetting the E-Stop

## 5. Reset E-Stop

Reset the emergency stop button by turning clockwise. Refer to Figure 4-4. The status display on the base will change from ABORT in red to POWER in green.

## 6. Turn Power ON

Turn on the AC power switch.

## 7. Set Tool Parameters

On the touch screen, press the SETUP button. Press Enter on the ENTER SECURITY CODE screen if no password has been previously set, or type in the password and then Enter. Press the TOOL Setup button and enter the TOOL Inertia ( $\text{kg}\cdot\text{cm}^2$ ) and TOOL Weight (kg). Press the RUN button and wait until the *PLEASE WAIT...* indicator above it disappears.

## 8. Initialize (Home) Welder

The touch screen will now instruct you to Activate both RUN SWITCHES to reset machine. This is illustrated in Figure 5-1. Once the switches are activated, both servos will first move to their respective home positions (corresponding to internal encoder reference pulses in each servo). Then the spin motor will rotate to the programmed final weld orientation set in the SETUP > WELD tab > Orientation > Weld field (Figure 5-17), and the press will move to position set in the SETUP > PRE-WELD tab > TOP OF STROKE Position > Position (mm) field (Figure 5-8). The switches can be deactivated once a beep sounds. The homing procedure is complete after the second beep sounds and the indicator directly below the yellow face icon becomes green.

## 9. Align Lower Fixture with Spin Tool

Place a set of parts in the upper tool and lower fixture. Navigate to the SETUP > TRIGGER Position menu, press the DOWN button, and select Me or Hi in VERT. Jog Speed. Jog the press head down to a position where the weld joint can be used to align the lower fixture by activating both RUN SWITCHES. Change the vertical jog speeds as needed and use the UP button to move the head up if desired. When finished, press the DONE button and remove the parts.

Since the welder press force is limited in jog mode for safety purposes, the machine will disable the servos and report an error (Fault: Jog thrust limit exceeded OR Vertical servo runaway detected.) if the press is jogged down too far. If this condition occurs, the welder must be re-initialized by returning to the RUN screen, pressing RESET FAULT button, and repeating welder initialization (Step 8).

## **10. Set Vertical Travel Lower Limit Position**

To protect tooling, set the vertical press travel limit using the following steps :

1. Navigate to TOOLS > SYSTEM SETUP tab and press the VERTICAL TRAVEL LOWER LIMIT button.
2. Press the Initialize button and wait 1 minute.
3. Press the DOWN button, then activate both RUN SWITCHES to move the head down to the position where the lower limit proximity switch should be activated (at least 4 mm [.15 in.] above tooling contact, if possible, since the physical hard stop is lower than the switch position by this distance). To change speed, select a different setting in the VERT. Jog Speed box.
4. Press the Set Position button, and wait until a flashing red circle appears next to the DOWN button.
5. Press DONE.

## **11. Set Weld Process Parameters**

Select the desired setup number (1 through 8; setup 1 is default) from the TOOLS > SELECT SETUP tab menu. Input the desired weld process settings in the PRE-WELD, WELD, and POST-WELD tabs in the SETUP menu as described in Chapter 5.

## Starting A Weld Cycle

All weld cycles must be initiated from the RUN screen after the machine is initialized and with the press at the top-of-stroke position. If not already on this screen, press the RUN button first (see Figure 5-2). If you had powered down the welder or pressed the Abort button, the screen may instruct you to press the RESET FAULT button and then reset the machine by activating the RUN switches. After the reset process is completed, the welder is ready to run a cycle, which is indicated by the smiley face in the upper left corner of the screen. If a frowning face appears instead, it signifies that the welder is not ready for one of several reasons (for example, the part presence sensor is not activated if the Part Present option is enabled).

To run a cycle, press both RUN switches simultaneously. The press will begin to descend and spin motor will accelerate. Both servos will reach their programmed weld speeds by the time the press reaches the trigger position (defined in **SETUP > PRE-TRIGGER tab > TRIGGER Position**). The Trigger Indicator (see Figure 4-1) will turn on when the weld starts, which occurs at the Trigger position if the Torque Trigger Option is disabled, or when the trigger torque is sensed if the Torque Trigger Option is enabled. The weld phase continues until the selected welding parameter (time, number of rotations, vertical distance, or energy) has been reached, at which point the Trigger Indicator turns off. The spin motor then stops and the welder begins the hold phase, during which the press moves according to the settings defined in the Hold Setup menu. To complete the cycle, the press retracts to the top-of-stroke position and the RUN screen is populated with weld process data results. The base switches must remain actuated until the start of the hold phase; otherwise, the cycle will be aborted and no weld data will be displayed.

If a weld cycle completes successfully, the smiley face appears to indicate that the machine is ready to run another cycle. If a cycle terminates abnormally, a fault message will be displayed on the screen describing the error condition. The fault must be cleared and the welder reset before another cycle can be initiated.



# Stopping a Weld Cycle

During normal operation, the cycle stops automatically when the specified weld and hold phases are completed and the press returns to the top-of-stroke position. To stop a cycle before it completes, press the E-stop switch on the base, which terminates the cycle and causes power to be removed from both servo motors.

# Setup Sheet

On the following page is a table containing all the machine settings for the Dual Servo Spin Welder. An electronic version is provided on the CD included with the machine.

# **DUKANE DUAL SERVO SPIN WELDER - SETUP SHEET**

APPLICATION		MACHINE MODEL	SVT0 2VR
DATE		MACHINE SETUP NUMBER	

TOUCH SCREEN SETTING						VALUE				
SETUP > PRE- WELD	TOOL SETUP	TOOL INERTIA (KG*CM^2)								
		TOOL WEIGHT (KG)								
		SPIN DECEL. (%)								
		VAC. SENSE				ON   OFF				
		PART PRESENT				ON   OFF				
	TOP OF STROKE POSITION		POSITION (MM)							
	TRIGGER POSITION		POSITION (MM)							
	OPTIONS	PART PICKUP	ENABLE	POSITION (MM)		ON   OFF				
THRUST SENSE			THRUST (%)	TIMEOUT (S)	ON   OFF					
PRE-SPIN ORIENT		PRE-SPIN		ON   OFF						
SETUP > WELD	METHOD (TIME, ROTATION, DISTANCE, ENERGY)					TIME   ROT   DIST   ENERGY				
	WELD PARAMETERS	WELD TIME (S) / WELD ROTATIONS / VERTICAL (MM) / ENERGY (J)								
		COLLAPSE / ABSOLUTE (DISTANCE METHOD ONLY)					COLLAPSE   ABSOLUTE			
		VERT. SPEED (MM/S)								
		SPIN RPM								
		DIR.					CW   CCW			
	OPTIONS	ORIENTATION	WELD			ON   OFF				
		TORQUE TRIGGER	TORQUE (% OF MAX.)	TIMEOUT (S)		ON   OFF				
CONSTANT TORQUE		TORQUE (% OF MAX.)	TIMEOUT (S)		ON   OFF					
SETUP > POST- WELD	HOLD SETUP	MODE (POSITION, TIME)				POSITION   TIME				
		SPEED (MM/S)								
		MOVE TIME (S) / COLLAPSE (MM)								
		DWELL TIME (S)								
		CONSTANT THRUST	THRUST (%)			ON   OFF				
	PROCESS LIMITS...	WELD TIME (S)				LOWER LIMIT		UPPER LIMIT		
		WELD ROTATIONS								
		ORIENTATION (DEG.)								
		WELD ENERGY (J)								
		PEAK RPM								
		PEAK TORQUE (% OF MAX.)								
		PEAK THRUST (% OF MAX.)								
		CYCLE TIME (S)								
		VERTICAL WELD END (MM)								
		HOLD COLLAPSE (MM)								
	HOLD END POSITION (MM)									
	LATCH ON FAILURE					ON   OFF				
	FAILURE SWITCH (SUSPECT / BAD)					SUSPECT   BAD				
TOOLS > SYSTEM SETUP	VERTICAL TRAVEL LOWER LIMIT		LIMIT POS. (MM)							
	HOME OFFSET (DEG.)									

# SECTION 7

## Optimizing Performance

---

Spin Welding Process .....	59
Material Considerations.....	59
Control Parameters .....	60
Surface Speed (RPM).....	60
Press (Axial) Speed .....	62
Weld Depth .....	62
Hold.....	63
Part Size .....	63

*This page intentionally left blank*

# Spin Welding Process

The formal definition of spin welding is “An assembly process in which thermoplastic parts with rotationally-symmetric mating surfaces are joined together under pressure using unidirectional circular motion. The heat generated during the rotational contact melts the plastic in the heat-affected zone forming a weld upon cooling.” Note that the parts themselves can be any shape, only the mating surfaces to be welded need to be circular.

The spin welding process is divided into five distinct phases. In Phase I, the rotational friction generates heat. Frictional heating is intensified with both axial (press vertical) and joint surface velocities. In Phase II, the friction results in abrasive forces which strip off surface roughness, generating wear particles causing the surfaces of the polymer to begin to melt. As the polymer reaches its crystalline melting point or glass transition temperature, it enters Phase III, where heat starts to be generated by internal friction within the molten region. This continues in Phase IV, where the temperature of the molten layer remains relatively constant. Because plastics are poor conductors of heat, the surface heat is transferred slowly to the interior and much of it remains localized. At this point, the rotation is stopped and we enter Phase V where the molten material is allowed to cool under pressure for a short period called the Hold Time.

## Material Considerations

Materials that can be friction (i.e. vibration) welded can also be joined with by spin welding. The semicrystalline thermoplastics are more readily joined using spin welding than ultrasonics. Using compatible polymers, spin welding is capable of making reliable hermetic seals. Far-field welding is easier with spin welding than with ultrasonic welding. Additional parts can be entrapped between the upper and lower pieces during spin welding.

Joining of dissimilar polymers is possible using the spin weld process although it generally produces lower strength weld joints. By designing the weld joint with an undercut, the polymer with the lower melting temperature will flow into the undercut, creating a mechanical union.

Material filler and surface contaminants (e.g. mold release agent) are two factors that will affect consistency and weld repeatability. Spin welding is more tolerant of contaminants than ultrasonic welding. Spin welding is also less affected by hygroscopic polymers, although they may still require special handling for critical applications. The moisture content can lead to bubble formation in the joint resulting in decreased weld strength.

#### **NOTE**

Common hygroscopic thermoplastics:  
ABS/Polycarbonate (Cycloy)  
Polyoxymethylene (Acetal, Delrin)  
Polyamides (Nylon, Zytel)  
Polycarbonate (Lexan)  
Polycarbonate/Polyester (Xenoy)  
Polysulfone (Udel)

## **Control Parameters**

There are several primary process control parameters that affect weld quality. They are the surface velocity of the weld joint, press (axial) speed, weld depth, and hold distance and time.

The following sections are presented for informational purposes only and are in no way meant to serve as a rule or formula. The information is collected from publicly available books and papers. It is presented here to provide you with a general guideline for setting the initial parameters.

## **Surface Speed**

For a fixed rotational spin speed (RPM), linear surface speed increases with weld joint diameter. For a fixed weld joint diameter, surface speed increases with motor RPM. Smaller diameter parts therefore usually require more RPM than larger parts of the same material. If the surface speed is too low, an adequate amount of heat will not be generated to cause sufficient melting. If the speed is too high, excessive heat in the joint could result in material degradation or reduction in viscosity leading to material flow away from the joint.

The selection of the proper surface speed depends to a large degree on the material and joint geometry of the parts being welded. Some materials, such as PVC, can be readily welded for a wide range of values, while others require a narrow range. Commonly quoted values in the literature recommend using

surface speeds between 360 and 600 in./sec. However, speeds of 120 in./sec. and lower have been used with good results. The mathematical relationship between surface speed and spin speed (RPM) is given by the equation:


$$\text{RPM} = \frac{60 v}{\pi D}$$

where

$v$  is the surface velocity

$D$  is the average weld diameter

A plot of the spin speed and average weld diameter for a number of surface speed values is shown in Figure 7-1.

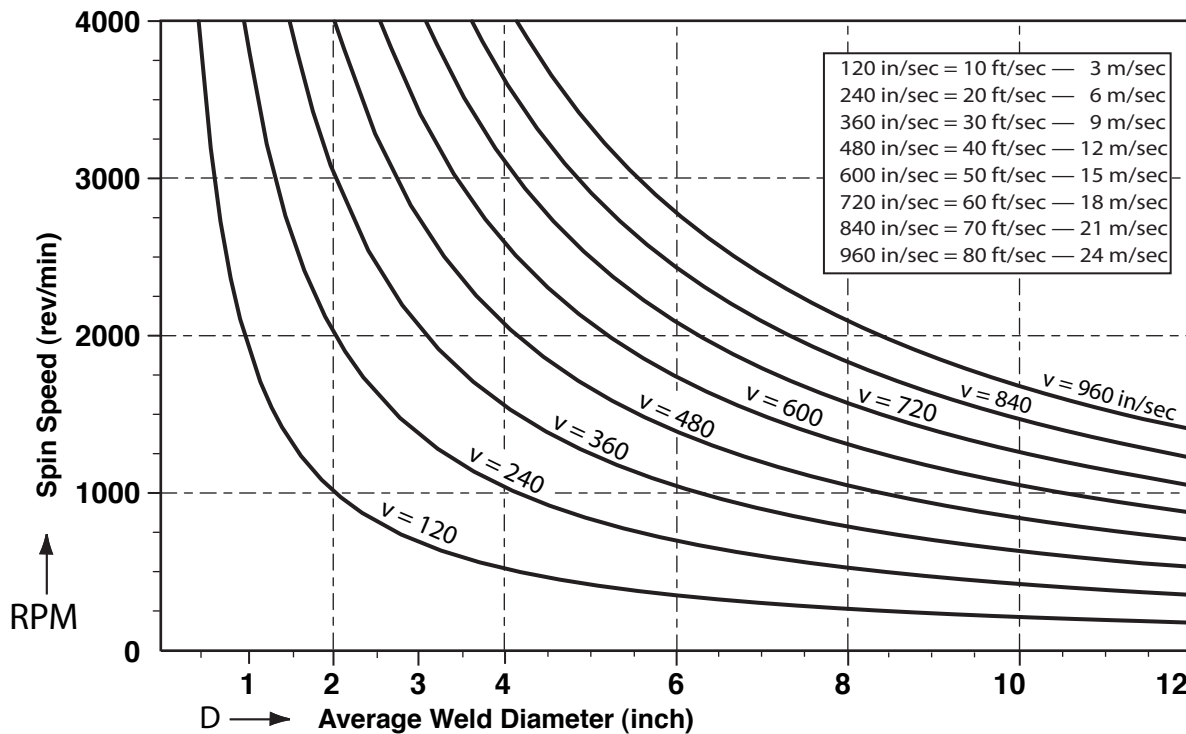

**Figure 7-1** Dependence of Spin Speed on the Weld Diameter for Selected Surface Speeds

## Press (Axial) Speed

The press speed affects the amount of contact pressure between the parts being welded, which is required to generate frictional heat. The larger the speed, the larger the rate of heat rise. In combination with the surface speed, press speed must be high enough to cause melting at the interface as opposed to grinding, but not too high as to damage the parts. Excessive press speed can also lead to stalling of the spin motor as more torque is required to maintain constant spin speed.

The Dual Servo Spin Welder is capable of operating in two different press speed modes. With the Constant Torque Option (in SETUP > WELD tab) disabled, the press speed is constant during the weld. With the Constant Torque Option enabled, the press speed is variable so as to keep the spin torque constant (see Chapter 5). The latter case resembles the operation of a pneumatically driven press, where the press speed is the result of the melt rate under given air pressure and spin speed conditions.

Selection of the optimum press speed depends on the material and joint geometry of the parts, as well as the surface speed. A range for initial experimentation is 0.5 to 2.0 mm/s.

## Weld Depth

The determination of the proper weld depth is highly dependent on the application. The weld joint is typically designed for a specific weld penetration. Ideally, the weld is sufficiently deep to produce a strong, hermetically sealed assembly. An excessive depth may lead to the formation of flash (material that is ejected from the joint area during the weld and adheres to the assembly), the drawing out of reinforcing filler material and realignment of the interchain bonds in the weld plane resulting in a weak axial weld joint, and possibly part distortion.



Since weld depth affects the joint strength and the amount of flash generated, it is important to design the weld joint properly to meet both requirements simultaneously. The incorporation of flash trap features is recommended to produce acceptable appearance without compromising strength.

## Hold

During the hold phase, vertical press travel initially brings the molten parts closer together (dynamic hold) and then allows the molten material to solidify (static hold). Amorphous plastics will normally take longer to solidify than semicrystalline plastics. The dynamic hold distance is typically a small value compared to the weld distance. An approximate starting point for initial application setup is 10% of weld distance. The static hold time can vary depending on the size of the part, but is usually in the 1-3 second range.

## Part Size

Machine model selection will mostly depend on the weld diameter of the parts. Refer to Table 7-I for approximate guidelines.

For diameters under 4 inches, the SVT032VR model is recommended due to its torque capacity. The SVT042VR model is used where high RPM (>3000) is required.

Please contact the Dukane Applications Laboratory (see Chapter 11) for a recommendation concerning your specific application.

Weld Diameter Range (in)	Machine Model	Peak RPM
up to 2.0	SVT042VR	4000
.5 to 4	SVT032VR	3000
4 to 7	SVT012VR	750

Table 7-I

*This page intentionally left blank*

# SECTION 8

## Welder Data Export Software

---

Introduction.....	67
Hardware and Software Requirements .....	67
Installation, Startup and Cable Connections .....	67
Part Data .....	68
Profile Graphs.....	69
Servo and Debug.....	70

*This page intentionally left blank*

# Introduction

A Windows™ application named Dual Servo Spin Welder Utility, can be used to capture data exported by the welder to a PC. This application is also capable of importing the servo tuning database, and obtaining messages from the machine that may be useful in troubleshooting.

## Hardware and Software Requirements

The utility requires a PC or laptop running a Windows 2000™, XP™, or Vista™ operating system. A straight DB-9 cable is needed to interface to the welder. The cable must be terminated with a male connector where it connects to the welder.

## Installation, Startup, and Cable Connections

To install the program, Run the *setup.exe* file located in the Dukane Dual Servo Spin Utility Installer folder on the CD supplied with the welder and follow the prompts on the screen.

Once installed, run the program. It can be accessed through:

Start Menu -> All Programs -> Dukane -> Dual Servo SpinWelder Utility

Connect the cable between the Data Port on the welder (located above the power switch on the rear of the welder) and a serial port on the PC or a USB-to-serial converter. If a converter is to be used, the serial communications settings should be as follows:

PARAMETER	VALUE
Baud Rate	57600
Data Bits	8
Parity	NONE
Stop Bits	1
Flow Control	Xon/ Xoff

## Part Data

Upon startup, the screen will appear as shown in Figure 8-1, with the Part Data tab selected by default.

The following is a description of the items on this tab:

### PART DATA List

This area contains a series of lines of part data, one line per part. This data is displayed after each cycle if the Data Export option in the System Setup screen on the welder is enabled (See Figure 5-32.). The data is comma delimited with the fields given in the order as follows:

1. Part number (ID)
2. Test result number
3. Test result symbol
4. Date
5. Time
6. Weld time (sec.)
7. Number of weld revolutions
8. Weld energy (Joules)
9. Peak spin motor RPM
10. Peak spin motor torque (% of max.)
11. Weld orientation (degrees)
12. Peak vertical thrust (% of max.)
13. Cycle time (sec.)
14. Weld end distance (mm)
15. Hold relative (collapse) distance (mm)
16. Hold end distance (mm)

### CLEAR

Clears parts data from PC screen.

### WRITE TO FILE

Writes parts data from the screen to a file on the computer. After pressing this button, enter the name of the file where to store the data. Add a *.txt* or *.csv* extension to the end of the file name as the generated file is in ASCII format. Saving the file with a *.csv* extension will allow it to be opened directly with Microsoft Excel™.

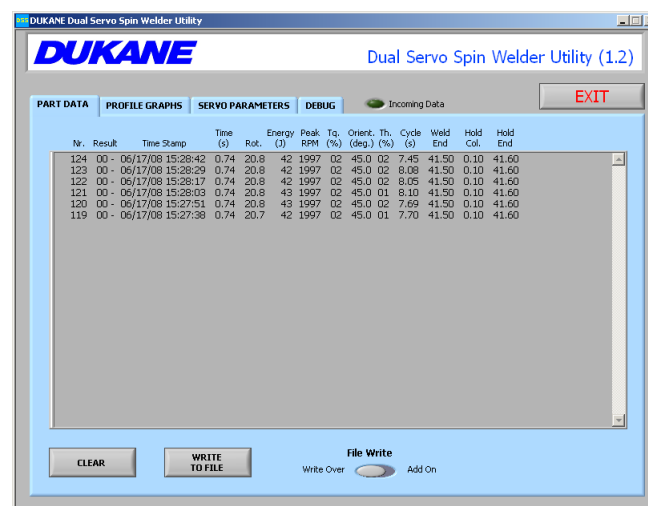


Figure 8-1 Utility Startup Screen

## File Write

Sets the write behavior for an existing file. **Write Over** overwrites an existing file, while **Add On** appends data to the end of the file.

## Incoming Data

This indicator will flash when data is being received from the welder.

## EXIT

Exits program.

# Profile Graphs

The PROFILE GRAPHS tab, shown in Figure 8-2, contains numerical and graphical representations of the following weld parameter profiles with respect to time for the last cycle:

1. Spin Position (rev.)
2. Torque (% of max.) - spin motor torque
3. Vertical Distance (mm)
4. Thrust (% of max.) - vertical actuator thrust
5. Vertical Speed (mm/s)

This data is exported by the welder after each cycle if the Graph Export option in the System Setup screen is enabled (see Figure 5-32). It can also be exported on demand by pressing the EXPORT LAST WELD GRAPH DATA button in the Utilities screen (see Figure 5-30).

## Plot Data

The profile data is displayed in this box with comma-separated values. The first line is a header row, containing the following parameters: total number of samples, sampling rate prior to trigger (ms), sampling rate during weld (ms), sample number at which weld started, torque trigger setting (% of max. / 10).

## Plot

The plot shows all the profile curves (vertical axis) with respect to time (horizontal axis) in milliseconds. The icons immediately above the plot contain tools for a more detailed examination of the plot. Both the horizontal and vertical scale end values can be changed by double-clicking on the desired number and entering a new value.

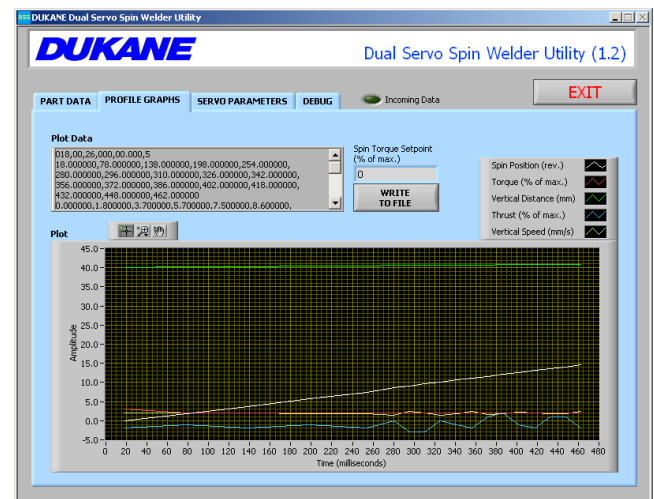


Figure 8-2 PROFILE GRAPHS Tab

## Spin Torque Setpoint

If torque triggering is enabled, the Torque Trigger value is displayed in this box for reference as a percentage of the spin motor maximum.

## WRITE TO FILE

Writes the torque data to a file. Add a *.txt* or *.csv* extension to the end of the file name as the generated file is in ASCII format.

## Servo and Debug

The SERVO PARAMETERS tab provides the ability to import a servo tuning database file. This database contains parameters necessary for proper operation of the machine for different upper tool sizes. It is set at the factory and stored on the welder in non-volatile memory. It will need to be modified only in cases where the database requires customization. The procedure of changing the database should only be performed with guidance from Dukane. Improper execution of the procedures could render the welder inoperable.

The DEBUG tab is used to retrieve troubleshooting information from the welder if it is not operating properly. The welder will display the letters DB on the upper left side of the touch screen when it is put in debug mode. If the use of this function becomes necessary, instructions will be provided by Dukane.



---

# SECTION 9

## Troubleshooting

---

Welding Process.....73

    Material Choice .....73

    Parameter Effects .....73

    Troubleshooting .....73

Welder .....74

    Mechanical .....74

    Electrical Power .....74

    Base Interface Cable.....74

    Machine Display Messages .....74

Table 9–I Welding Process  
    Troubleshooting.....75

Table 9–II Machine Display Messages ... 76-79

*This page intentionally left blank*

# Welding Process

## Material Choice

A family of thermoplastics is usually compatible with its own type and sometimes with other types. Characteristics to consider are the melting point and coefficient of linear expansion. Even members of the same family may cause problems due to differences in the manufacturing process. For example, an extruded Polyethylene (PE) piece may not weld as well to an injection molded PE piece as it would to another extruded PE piece.

## Parameter Effects

### Surface Speed

Insufficient surface speed may not allow the plastic to reach its melting temperature. Instead, it may simply erode away part of the material and stick by a clawing effect. The surface speed is determined by both the weld joint diameter and the spin motor speed.

### Axial Speed

In conjunction with surface velocity, axial speed determines whether the plastic reaches the melting temperature. Both surface and axial speed are needed to produce sufficient frictional heating. Excessive axial speed may cause one part to scrape away part of the surface and produce a lot of flash but insufficient melt volume.

### Weld Depth

Insufficient welding depth may not allow the melt to propagate far enough into the plastic to achieve the necessary melt volume and the required weld strength.

### Hold Time

Insufficient holding time may prevent the plastic from solidifying and forming a strong permanent bond.

## Troubleshooting

Table 9-I lists some potential problems with the weld process and suggested solutions.

# Welder

## Mechanical

The part fixture should be securely mounted perpendicular to, and centered under the spin axis.

## Electrical Power

Make sure the AC power cord is plugged in to a 240 VAC, 1-phase electrical outlet with a 20 Ampere capacity. Check that the circuit is live. Also refer to Electrical Safety in Chapter 2.

## Base Interface Cable

The cable must be plugged in to the base and the back of the press. If the cable is not plugged in, or has a fault, the base switches will not initiate any action, and the **ABORT** and **POWER** indicators on the base status display will not function.

## Machine Display Messages

A list of all machine messages, their meaning, and possible solutions to problems are given in Table 9-II.

**Table 9–I** Welding Process Troubleshooting

Problem	Symptom	Possible Cause	Recommended Solution
Overwelding	Excessive weld flash	Weld Time or Distance are too large	Reduce Weld Time or Distance
	Welded assembly dimensions are too small	Incorrect flash trap design	Evaluate and correct flash trap design
Underwelding	Low strength weld	Weld Time or Distance are too small	Increase Weld Time or Distance
	Welded assembly dimensions are too large	Material difficult to weld due to low friction coefficient	Degrease joint interface to remove mold release agent Consider changing material (i.e. avoid PTFE)
Nonuniform or inconsistent weld joints	Excessive weld flash	Warped parts	Check part dimensions
		Uneven weld interface	Check molding process conditions
		Fixture and part are not parallel	Level fixture where necessary Check that tooling is true to table
		Poor alignment of parts in tool and/or fixture	Change part or tool dimensions Improve part tolerance due to cavity
	Low weld strength	Insufficient fixture support	Check for parts shifting during welding
		Failure when leak tested	Provide features in parts for rotational driving (i.e. drive ribs or cavities)
	Part failure in service	Part walls flexing during weld	Redesign parts with reinforcing ribs and/or tongue-and-groove joints
		Excessive filler or uneven distribution	Reduce amount of filler Improve processing conditions to ensure even distribution of filler
		Moisture in parts	Prevent moisture absorption after molding prior to welding Dry parts before welding
Final part orientation different from programmed orientation	Parts not aligned properly	Deceleration too low	Increase spin deceleration as high as possible (if set too high, welder will fault with tracking errors)
		Vertical speed too high	Reduce speed to decreased spin torque required
		Poor tuning	Determine and enter tool inertia correctly into Setup Contact DUKANE for special tuning requirements
		Parts not held properly by tool or fixture	Ensure tooling does not allow excessive play

**Table 9-II** Machine Display Messages

Message	Description	Cause	Possible Solution
<b>Instructions</b>			
Activate both RUN SWITCHES to reset machine	Resetting of machine at startup or recovery requires the activation of both optical switches on base.	-	-
Activate both RUN SWITCHES to reset machine after all motion stops	Resetting of machine at startup or recovery must be initiated when the spin tool and press are stationary.	-	-
<b>Faults</b>			
Axis move aborted	Expected servo move was not completed	Internal machine error	1. Check for obstructions to motion outside welder 2. Contact DUKANE service
Home index edge not found	Spin or vertical servo motor internal index pulse(s) not detected	Internal machine error	Contact DUKANE service
Improper servo operation request	Servo controller error	Internal machine error	Contact DUKANE service
Jog thrust limit exceeded OR vertical servo runaway detected	Press thrust (force) was exceeded during jogging operations OR servo system entered runaway condition	1. Press is jogged in a way to produce a force on the parts larger than allowed in jog mode (most common cause) 2. Servo system feedback is malfunctioning	1. Prevent press from applying a large force on the parts in jog mode 2. Contact DUKANE service
Operator E-Stop	E-stop activated	Operator pressed E-stop switch	Reset E-stop switch then reset machine
Part pickup not detected	Sensor for upper tool vacuum not activated when expected	1. No part present to pick up 2. Loss of vacuum between part and tool	1. Ensure part is present for pickup 2. Check vacuum between part and tool (line connections, vacuum generator, tool wear)
Part presence not detected	Part presence sensor did not detect part	1. Part not present 2. Problem with sensor	1. Ensure part is present 2. Troubleshoot sensing components
RUN SWITCH(ES) released too soon	Optical switches on base were de-activated during weld cycle	Switches were released after weld cycle started but before the spin motor stopped	Once weld cycle is started, ensure switches remain activated until spin motor stops (i.e. at beginning of hold phase)
Servo CPU no Idle before Run	Motor controller error	Internal machine error	Contact DUKANE service
Servo CPU program error	Motor controller error	Internal machine error	Contact DUKANE service
Servo database import failed	Servo tuning database import failed	1. Import procedure problem 2. Cable problem 3. Machine component failure	1. Contact DUKANE for import procedure 2. Check that the correct cable is used and that it is securely connected 3. Contact DUKANE service
Servo param select by inertia failed	Servo tuning data not found for the tooling inertia entered	1. Tooling inertia entered is outside allowable range 2. Servo tuning database is missing	1. Enter tooling inertia within limits stated in this manual 2. Contact DUKANE regarding importing servo tuning database
Slide In timeout	Slide did not move to the commanded position within the allowable time	1. Air pressure to slide too low 2. Slide limit switch improperly positioned 3. Slide jammed	1. Increase air pressure 2. Adjust slide switch position 3. Ensure slide can move freely
Slide Out timeout	see <i>Slide In timeout</i> fault		
Spin aborted	Weld cycle was aborted	Internal machine error	Contact DUKANE service
Spin at travel limit	Number of servo motor rotations has exceeded controller counting capability	Weld time or number of rotations too large	Reduce weld time, distance, or number of rotations

**Table 9-II** Machine Display Messages (*continued*)

Message	Description	Cause	Possible Solution
Spin motor not on	Spin servo amplifier does not power up	Internal machine error	Contact DUKANE service
Spin servo amplifier faulted	There is a problem with the spin servo amplifier	<ol style="list-style-type: none"> <li>Excessive spin deceleration</li> <li>Excessive press weld or hold speed</li> <li>Amplifier disabled due to excessive temperature</li> <li>Amplifier failed</li> </ol>	<ol style="list-style-type: none"> <li>Reduce deceleration</li> <li>Reduce speed(s)</li> <li>a) Reduce machine duty cycle b) Ensure temperature around machine is within operational limits</li> <li>Contact DUKANE service</li> </ol>
Spin servo tracking error	The spin servo motor was not able to execute the spinning motion programmed in the setup	<ol style="list-style-type: none"> <li>Excessive press weld or hold speed(s)</li> <li>Excessive spin deceleration</li> <li>Joint weld diameter too large</li> <li>Improper tuning</li> </ol>	<ol style="list-style-type: none"> <li>Reduce speed(s)</li> <li>Reduce deceleration</li> <li>Use welder model with larger spin torque capability</li> <li>Ensure correct tool inertia is entered in touch screen</li> </ol>
Spin weld axis aborted	Expected spin servo move was not completed	Internal machine error	<ol style="list-style-type: none"> <li>Check for obstructions to motion outside welder</li> <li>Contact DUKANE service</li> </ol>
Timeout on servo CPU Thread 1(thrd1)	Motor controller error	Internal machine error	Contact DUKANE service
Timeout on servo response to command start	Servo system communication error	Internal machine error	Contact DUKANE service
Vertical at travel limit	Press travel distance exceeded controller counting capability	Press travel too large	Reduce weld time / distance / number of rotations, or hold distance
Vertical motor not on	Vertical servo amplifier does not power up	Internal machine error	Contact DUKANE service
Vertical servo amplifier faulted	There is a problem with the vertical servo amplifier	<ol style="list-style-type: none"> <li>Amplifier disabled due to excessive temperature</li> <li>Amplifier failed</li> </ol>	<ol style="list-style-type: none"> <li>a) Reduce machine duty cycle b) Ensure temperature around machine is within operational limits</li> <li>Contact DUKANE service</li> </ol>
Vertical servo tracking error	The vertical servo actuator was not able to execute the press motion programmed in the setup	Excessive press weld or hold speed	Reduce speed(s)
Vertical weld axis aborted	Expected vertical servo move was not completed	Internal machine error	<ol style="list-style-type: none"> <li>Check for obstructions to motion outside welder</li> <li>Contact DUKANE service</li> </ol>
Weld trigger position is below vertical travel lower limit	Cycle will not start since the programmed press travel is larger than the set limit	<ol style="list-style-type: none"> <li>Vertical travel lower limit set too high</li> <li>Trigger position too large</li> </ol>	<ol style="list-style-type: none"> <li>Lower vertical travel lower limit, if possible.</li> <li>Decrease Trigger position</li> </ol>

*Table 9-II continued. . .*

**Table 9-II** Machine Display Messages (*continued*)

Message	Description	Cause	Possible Solution
<b>Errors</b>			
Axis stopped before weld end	Motion on spin or vertical axes stopped before weld ended	Internal machine error	<ol style="list-style-type: none"> <li>1. Check for obstructions to motion outside welder</li> <li>2. Contact DUKANE service</li> </ol>
Spin stop before weld start	Servo controller error	Internal machine error	Contact DUKANE service
Timeout on finding vertical lower limit position	Moving the vertical lower limit up to desired position failed	Limit mechanism malfunctioning	Contact DUKANE service
Timeout on torque sense	The torque trigger was not detected within the allowable time	<ol style="list-style-type: none"> <li>1. Torque trigger value set too high</li> <li>2. Parts not loaded</li> </ol>	<ol style="list-style-type: none"> <li>1. Reduce torque trigger value</li> <li>2. Ensure parts are properly loaded</li> </ol>
Timeout on User Upper Part vacuum detect	Vacuum was not detected within timeout	<ol style="list-style-type: none"> <li>1. Insufficient vacuum</li> <li>2. Vacuum sensor threshold set too high</li> <li>3. Improper part pickup position</li> </ol>	<ol style="list-style-type: none"> <li>1. Increase vacuum capability</li> <li>2. Decrease required vacuum sensing level</li> <li>3. Adjust Position (mm) value in Part Pickup option</li> </ol>
Timeout on vertical distance in constant torque mode	Programmed weld distance not reached within the specified time with Constant Torque option enabled	<ol style="list-style-type: none"> <li>1. Timeout too short</li> <li>2. Constant Torque maximum vertical speed set too low</li> </ol>	<ol style="list-style-type: none"> <li>1. Increase timeout value</li> <li>2. Increase value of VERT. Max (mm/s) setting in Weld Parameters screen in setup menu</li> </ol>
Vertical stop before starting spin	Vertical (press) motion stopped before spin motion started	Internal machine error	<ol style="list-style-type: none"> <li>1. Check for obstructions to motion outside welder</li> <li>2. Contact DUKANE service</li> </ol>
Vertical servo contact sensing failed	Welder did not detect programmed thrust level	With Part Pickup option enabled with Thrust Sense, part contact was not detected	<ol style="list-style-type: none"> <li>1. Ensure parts are loaded properly</li> <li>2. Increase Timeout (s) value</li> <li>3. Check the Position (mm) value – it should be set slightly (&lt;5mm) above expected part contact</li> </ol>
Weld aborted by CYCLE TIME limit	Weld cycle stopped because cycle time exceeded programmed process limit	<ol style="list-style-type: none"> <li>1. Weld process problem</li> <li>2. Limits too narrow for weld process</li> </ol>	<ol style="list-style-type: none"> <li>1. Check parts to be welded, fixturing, etc.</li> <li>2. If practical, widen process limit window or adjust setup parameters</li> </ol>
Weld aborted by ROTATE limit	Weld cycle stopped because number of revolutions exceeded programmed process limit	<ol style="list-style-type: none"> <li>1. Weld process problem</li> <li>2. Limits too narrow for weld process</li> </ol>	<ol style="list-style-type: none"> <li>1. Check parts to be welded, fixturing, etc.</li> <li>2. If practical, widen process limit window or adjust setup parameters</li> </ol>
Weld aborted by RPM limit	Weld cycle stopped because motor speed was outside programmed process limit	<ol style="list-style-type: none"> <li>1. Weld process problem</li> <li>2. Limits too narrow for weld process</li> </ol>	<ol style="list-style-type: none"> <li>1. Check parts to be welded, fixturing, etc.</li> <li>2. If practical, widen process limit window or adjust setup parameters</li> </ol>
Weld aborted by THRUST limit	Weld cycle stopped because weld thrust was outside programmed process limits	<ol style="list-style-type: none"> <li>1. Weld process problem</li> <li>2. Limits too narrow for weld process</li> </ol>	<ol style="list-style-type: none"> <li>1. Check parts to be welded, fixturing, etc.</li> <li>2. If practical, widen process limit window or adjust setup parameters</li> </ol>
Weld aborted by TORQUE limit	Weld cycle stopped because motor torque was outside programmed process limits	<ol style="list-style-type: none"> <li>1. Weld process problem</li> <li>2. Limits too narrow for weld process</li> </ol>	<ol style="list-style-type: none"> <li>1. Check parts to be welded, fixturing, etc.</li> <li>2. If practical, widen process limit window or adjust setup parameters</li> </ol>
Weld aborted by vertical servo stop	Vertical (press) motion stopped before spin motion weld was complete	Excessive press weld speed	Reduce press weld speed
Weld duration too short	Weld duration generated by programmed parameters is too short	<ol style="list-style-type: none"> <li>1. Weld Time, Rotations, or Distance too short</li> <li>2. Deceleration too low</li> </ol> <p><i>NOTE: the time for deceleration is counted as part of the total weld time or number of rotations</i></p>	<ol style="list-style-type: none"> <li>1. Increase Weld Time, Rotations, or Distance above the "Min." value indicated on the Weld Parameters setup screen</li> <li>2. Increase spin deceleration</li> </ol>
Weld ended at TIME limit	Weld cycle stopped because weld time was outside programmed process limits	<ol style="list-style-type: none"> <li>1. Weld process problem</li> <li>2. Limits too narrow for weld process</li> </ol>	<ol style="list-style-type: none"> <li>1. Check parts to be welded, fixturing, etc.</li> <li>2. If practical, widen process limit window or adjust setup parameters</li> </ol>



**Table 9-II** Machine Display Messages (*continued*)

Message	Description	Cause	Possible Solution
<b>Warnings</b>			
Battery life limit, press Continue	The batteries in the PLC and touch screen need to be replaced	Batteries have not been replaced in approximately 5 years	Contact DUKANE service for information on battery replacement
Lower limit is greater than upper limit	Lower process limit is greater than Upper process limit	Improper process limit values entered	Correct process limit values
Move to Top Of Stroke before welding	Press head is not at Top of Stroke	Machine jogged away from Top Of Stroke position	Move press to Top Of Stroke position by using the "TOP OF STROKE Position" screen in setup menu
Process RPM is too high	Programmed spin motor weld speed is too high	Programmed spin weld speed is larger than machine capability	Reduce spin motor weld RPM
TOS to trigger distance is too small	Distance between Top Of Stroke position and Trigger position is too small	Trigger position is set too high or Top Of Stroke position is set too low	Increase Trigger position value or decrease Top of Stroke position value
Vertical weld speed is too high	Programmed press weld speed is too high	Programmed press weld speed is larger than machine capability	Reduce press weld speed
Weld duration too short	Weld duration generated by programmed parameters is too short	1. Weld Time, Rotations, or Distance too short 2. Deceleration too low <i>NOTE: the time for deceleration is counted as part of the total weld time or number of rotations</i>	1. Increase Weld Time, Rotations, or Distance above the "Min." value indicated on the Weld Parameters setup screen 2. Increase spin deceleration
Weld trigger position is below vertical travel lower limit.	Cycle will not start since the programmed press travel is larger than the set limit	1. Vertical travel lower limit set too high 2. Trigger position too large	1. Lower vertical travel lower limit, if possible. 2. Decrease Trigger position

*This page intentionally left blank*

# SECTION 10

## Maintenance

---

Touch Screen Display.....83

AC Power Cord.....83

Maintenance.....83

*This page intentionally left blank*

## Touch Screen Display

Do not use any solvents or abrasive cleaners on the touch screen. Apply a small amount of computer cleaner to a soft towel first. Clean the panel with the moistened towel. Do not spray or apply a cleaner directly to the interface panel.

Remove grease by rubbing lightly with isopropyl alcohol. Afterward, provide a final cleaning using a mild detergent and rinse with clean water.

Do not use any sharp objects on the display. It should not be touched unnecessarily. It is lit by a long-life LED backlight and should not require any maintenance other than occasional cleaning.

## AC Power Cord

The AC power cord should be kept in good condition and free from any cuts and abrasions. The AC plug should be straight with no bent prongs.

## Maintenance

Visually inspect cables once a week, and replace or repair if necessary.

Lubricate the unpainted area on the front of the support column as needed with conventional grease.



*This page intentionally left blank*

# SECTION 11

## Contacting Dukane

---

Contacting Dukane .....	87
Identify Equipment .....	87
Ultrasonics Division.....	87
Website .....	87

*This page intentionally left blank*



# Contacting Dukane

## Identify Equipment

When contacting Dukane about a service-related problem, be prepared to give the following information:

- SVT Model number and serial number
- Any error indicators from the Touch Screen Display
- Description of the problem and steps taken to resolve it

Some problems can be solved over the telephone, so it is best to call from a telephone located near the equipment.

## Ultrasonics Division

**Mailing Address:** Dukane Ultrasonics  
2900 Dukane Drive  
St. Charles, IL 60174 USA

**Main Phone:** (630) 797-4900

**Main Fax:** (630) 797-4949

**Service & Parts Fax:** (630) 584-0796

## Website

The website has information about our products, processes, solutions, and technical data. Downloads are available for many kinds of literature.

You can locate your local representative at:

**[www.dukcorp.com/us/sales/intsales.htm](http://www.dukcorp.com/us/sales/intsales.htm)**

*This page intentionally left blank*

# SECTION 12

## Specifications

---

Tooling Specifications .....	91
Machine Weight.....	91
Power Requirements .....	97
Operating Environment.....	97
Dimensions & 5–View Drawing .....	92
Identification Numbers.....	93
Regulatory Agency Compliance .....	93

*This page intentionally left blank*

# Tooling Specifications

## Tooling Size

Refer to Table 5-I for maximum tooling sizes.

## Machine Weight

The Dual Servo Spin Welder weighs approximately 400 lbs. (182 kg). It should be mounted on a table or bench capable of supporting 650 lbs. (295 kg) to accommodate the additional force imposed by the vertical movement of the motor and slide during the spin welding operation.

Use mechanical means such as a forklift or hoist to place the servo spin welder on its work bench. There are two 3/4 inch lifting eyes located at the top of the column (see Figure 3–7) for a lifting ring or strap.

## Power Requirements

The Dual Servo Spin Welder requires a 240 VAC 1–phase outlet rated at 20 Amps. All welder models use the same power cord and plug. The AC power cord has a 240 VAC, single phase plug which is designed for a NEMA 6–20R configuration wall receptacle shown in Figure 12–1.

## Operating Environment

Operate the Dual Servo Spin Welder within these guidelines:


- Temperature:** 40°F to 95°F (+5°C to +35°C)
- Altitude:** 4570 m (15,000 ft)
- Air Particulates:** Keep the welder dry.  
Minimize exposure to moisture, dust dirt, smoke and mold.
- Humidity:** 5% to 95% non–condensing @ +5°C to +30°C



Figure 12–1 240V AC Single–Phase AC Receptacle

Figure 12–2 Dual Servo Spin Welder Dimensions

NOTE: All specifications are subject to change without notice. The specifications listed are current at the time of publication.

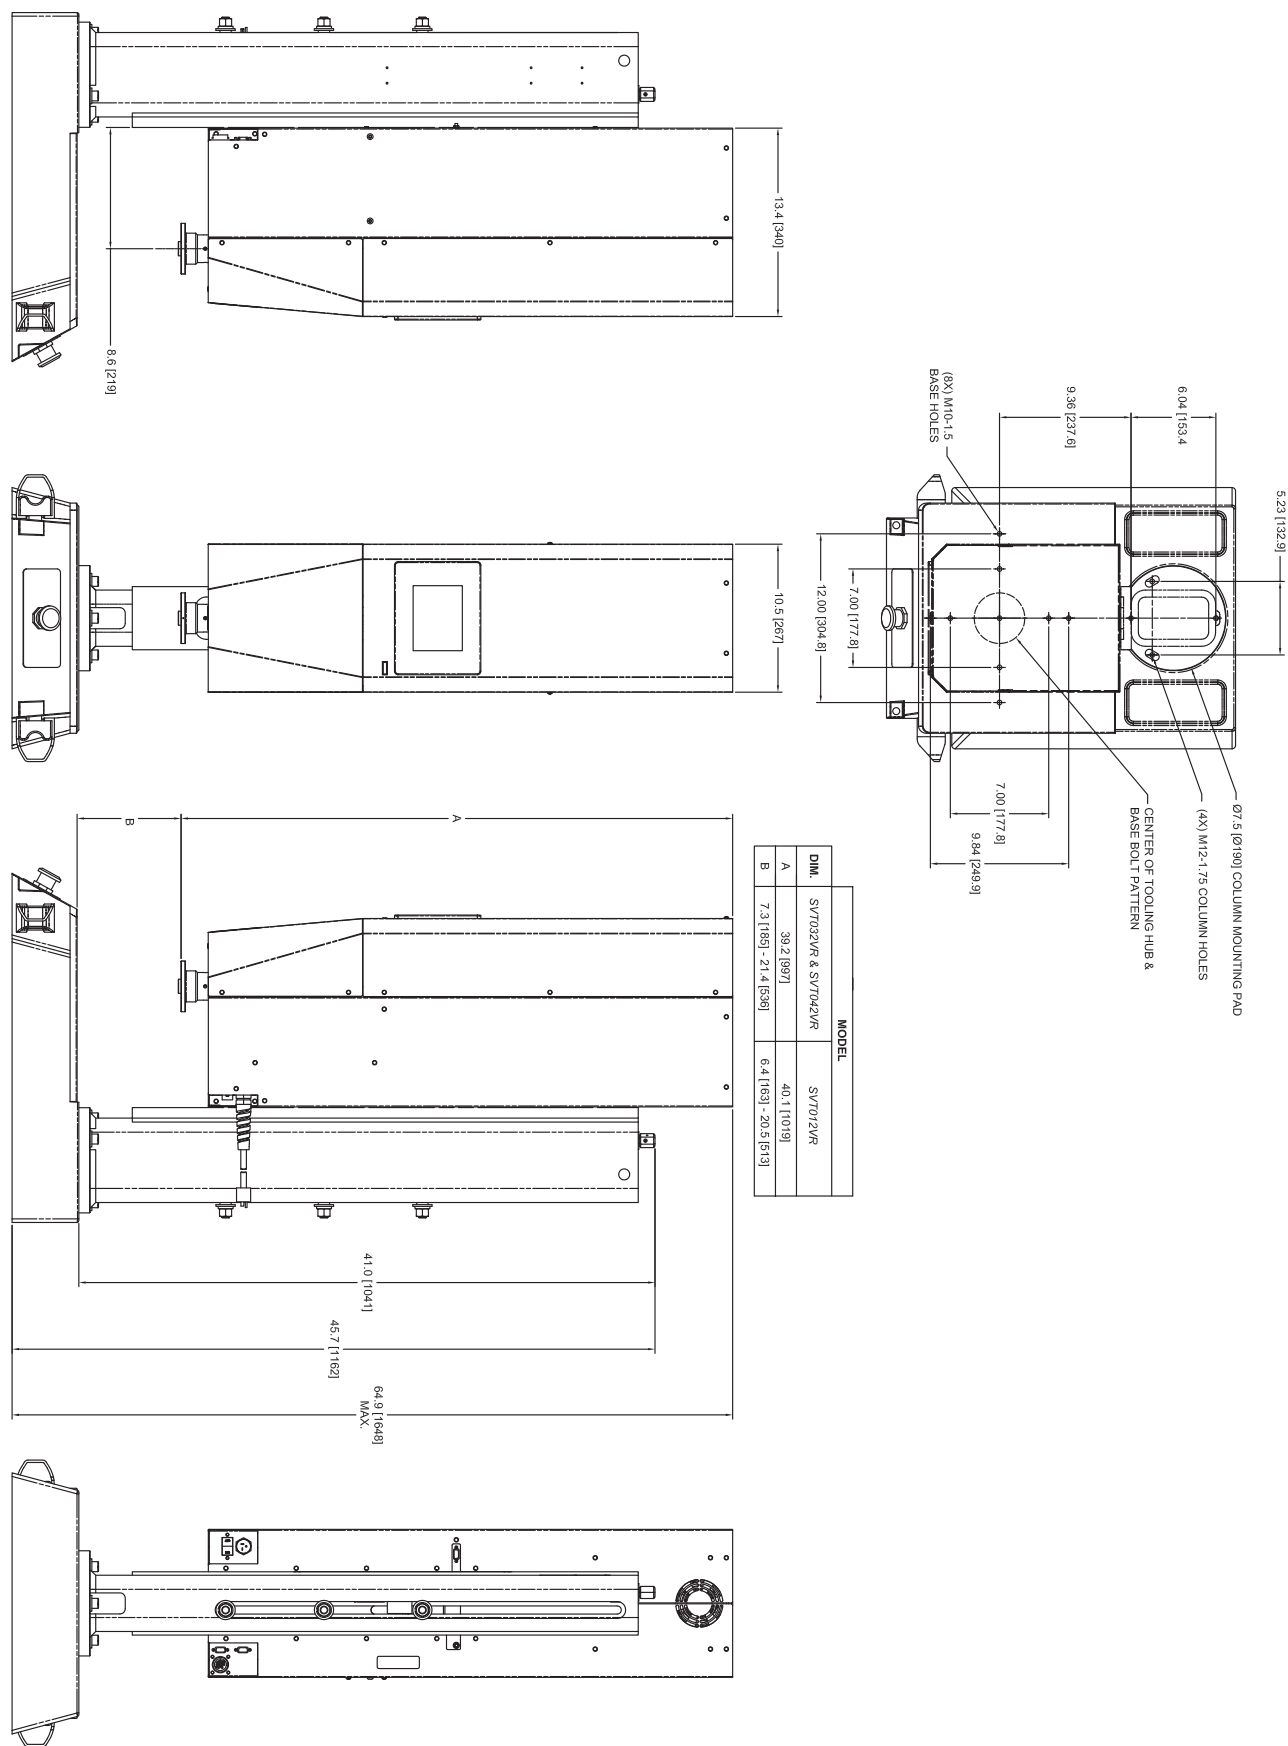

# Identification Numbers

## Welder Model & Serial Number

The serial number and model number tag for the Dual Servo Spin Welder are located either on the covers on the back of the machine or on the underside of the motor mounting plate just above the tooling hub.

## Regulatory Agency Compliance

### CE Marking

This mark on your equipment certifies that it meets the requirements of the EU (European Union) concerning interference causing equipment regulations. CE stands for Conformité Européenne (European Conformity). The Dual Servo Spin Welder complies with the following CE requirements.

- The EMC Directive 89/336/EEC
- The Low Voltage Directive 73/23/EEC.
- The Machinery Directive 89/392/EEC using EN60204-1:1993 Safety of Machinery – Electrical Equipment of Machines. Part 1: Specification for General Requirements.



#### CAUTION

DO NOT make any modifications to the Dual Servo Spin Welder. The changes may result in violating one or more regulations under which this equipment is manufactured.

*This page intentionally left blank*



# APPENDIX A

## Connector Pinouts

---


Base Interface Connector.....	97
User I/O Connector.....	98
Slide Kit Connector.....	99
Data Port Connector.....	100
Automation Wiring .....	100-101

*This page intentionally left blank*

# Base Interface Connector

The base interface connector is a DB 9–socket connector. A closeup of the base connector is shown in Figure 2–2, and a closeup of the rear thruster connector is shown in Figure 3–8. The pin numbers for the connector are shown in Figure A–1. The pin assignments and signal descriptions are given in Table A–I.

A schematic of the **Operate** and **Abort** switches connected through the base Interface Connector is shown in Figure A-5.

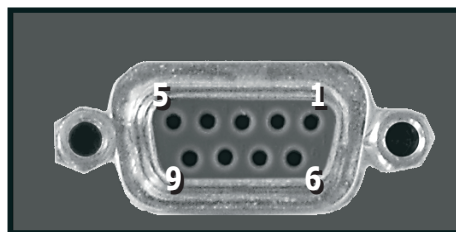

**Figure A–1** Base Interface Connector

Pin	Signal Description
1	Left Optical Switch Output
2	Right Optical Switch Output
3	+24 VDC Switched by E-Stop (Power OFF when Abort switch pushed)
4	Abort Signal
5	Ground
6	Ground
7	Ground
8	Automation Input
9	+24 VDC Power


**Table A-I** Pin Assignments and Signal Description for the Base Interface Connector

## User I/O Connector

The User I/O connector is a HD-15 connector located directly above the base interface connector on the rear of the thruster. The connector is shown in Figure 3-8. This connector provides access to signals for interfacing to custom automation equipment. The pin numbers for the connector are shown in Figure A-2. The pin assignments and signal descriptions are given in Table A-II.

Input signals, such as Vacuum On Sense, can be configured as sourcing or sinking using 24 VDC and Input Common. For example, to activate the Vacuum On Sense input, connect Input Common to ground and provide 24VDC on the input pin.

Outputs, such as Ready Status, are provided through relays rated at 1A@24VDC. Outputs provide contact closure to Output Common when active.

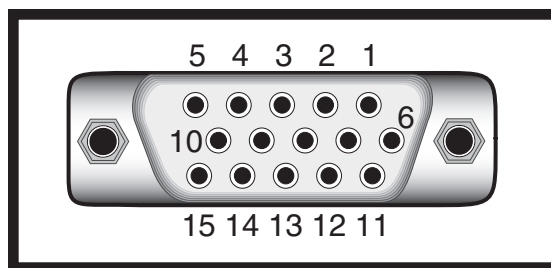


**Figure A-2** User I/O Connector

Pin	Signal Description	Function
1	Top-Of-Stroke Status Output	ON when press is at Top-of-Stroke position
2	Vacuum On Output, Part Pickup	ON when welder calls for vacuum to be turned ON with Part Pickup mode enabled
3	Bad Part Status Output	ON when weld process is outside defined limits with Bad option enabled
4	Suspect Part Status Output	ON when weld process is outside defined limits with Suspect option enabled
5	Vacuum On Output, No Part Pickup	ON when welder calls for vacuum to be turned ON with Part Pickup mode disabled (signal is deactivated if idle time between cycles is more than 5 minutes; one of the RUN SWITCHES must be turned on to reactivate signal)
6	Ready Status Output	ON when welder is ready to initiate a weld cycle
7	Output Common	Output Common connection
8	Fixture Clamp 1 (Right) Output	Function depends on configuration: Without slide or In/Out slide: ON at start of cycle; OFF at end of cycle With Left/Right slide: ON at start of cycle when slide is commanded to move to In (Right) position; OFF at the end of cycle.
9	Fixture Clamp 2 (Left) Output	Function depends on configuration: Without slide or In/Out slide: not used With Left/Right slide: ON at start of cycle when slide is commanded to move to Out (Left) position; OFF at the end of cycle
10	Spare Output 2	Not Used
11	Spare Output 3	Not Used
12	Vacuum On Sense Input	Activate when sufficient vacuum in upper tool has been detected
13	Automation Start Input	Activate to initiate a weld cycle (500 ms min.) with Start Type set to Automation
14	Input Common	Input Common Connection
15	Spare Input 1	Not Used

**Table A-II** Pin Assignments and Signal Description for the User I/O Connector

## Slide Kit Connector

The slide kit interface is a round 16-pin connector located directly to the right of the base interface connector on the rear of the thruster. The Dual Servo Spin Welder is prewired to accept a Dukane slide kit without any modification or reprogramming of the press. The connector is shown in Figure 3–8. The connector will interface to a Left/Right or an In/Out slide kit, and provides activation signals to extend and retract the slide table as well as readouts of the table position switches. It also provides an input for a signal from a part presence sensor. The pin numbers for the connector are shown in Figure A–3. The pin assignments and signal descriptions are given in Table A-III.

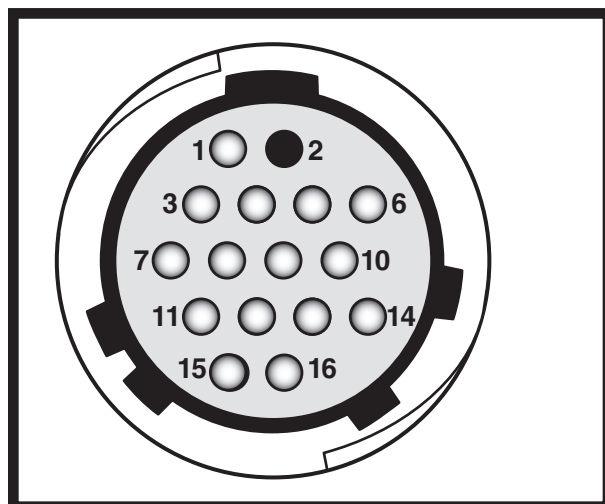

**Figure A–3** Slide Kit Connector

Pin	Signal Description	Function
1	Ground	Ground connection
2	(No Connection)	---
3	Slide Out Sense (Left) Input	Activate when slide is in Out (Left) position
4	Output Common	Output common connection
5	Top-of-Stroke Output (Closed at TOS)	ON when press is at Top-of-Stroke position
6	Slide In Sense (Right) Input	Activate when slide is in In (Right) position
7	In/Out Slide Identificaion Input	Activate to designate connected slide as In/Out type (ensure Pin 8 is disconnected)
8	Left/Right Slide Identificaion Input	Activate to designate connected slide as Left/Right type (ensure Pin 7 is disconnected)
9	Part Presence Sensor Input	Activate when part presence is sensed
10	Ground	Ground connection
11	Slide In (Right) Output	ON when welder calls for slide to move to the In (Right) position
12	Slide Home Status Output	ON when slide is in Home position NOTE: home slide position is Out (Left)
13	Ready Status Output	ON when welder is ready to initiate a weld cycle
14	Slide Out (Left) Output	ON when welder calls for slide to move to the Out (Left) Position
15	Ground	Ground connection
16	+24V DC Switched (Power OFF when Abort switch pushed)	+24V DC switched connection

**Table A-III** Pin Assignments and Signal Description for the Slide Kit Connector

## Data Port Connector


The computer interface connector is located on the back of the welder above the power switch as shown in Figure A-4. It provides a computer connection to export part data and weld profile graphs. The pin numbers for the connector are shown in Figure A-4.

## Automation Wiring


If the Dual Servo Spin Welder will be used in Automation mode, the signals normally generated by the optical switches and abort switch must be reproduced. Figure A-6 shows a wiring diagram and a description of the required signals.




**Figure A-4** Data Port Connector Location

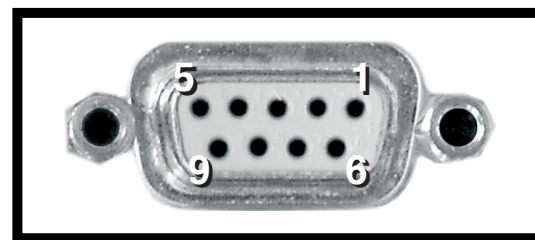

**Figure A-5** Data Port Connector Pins

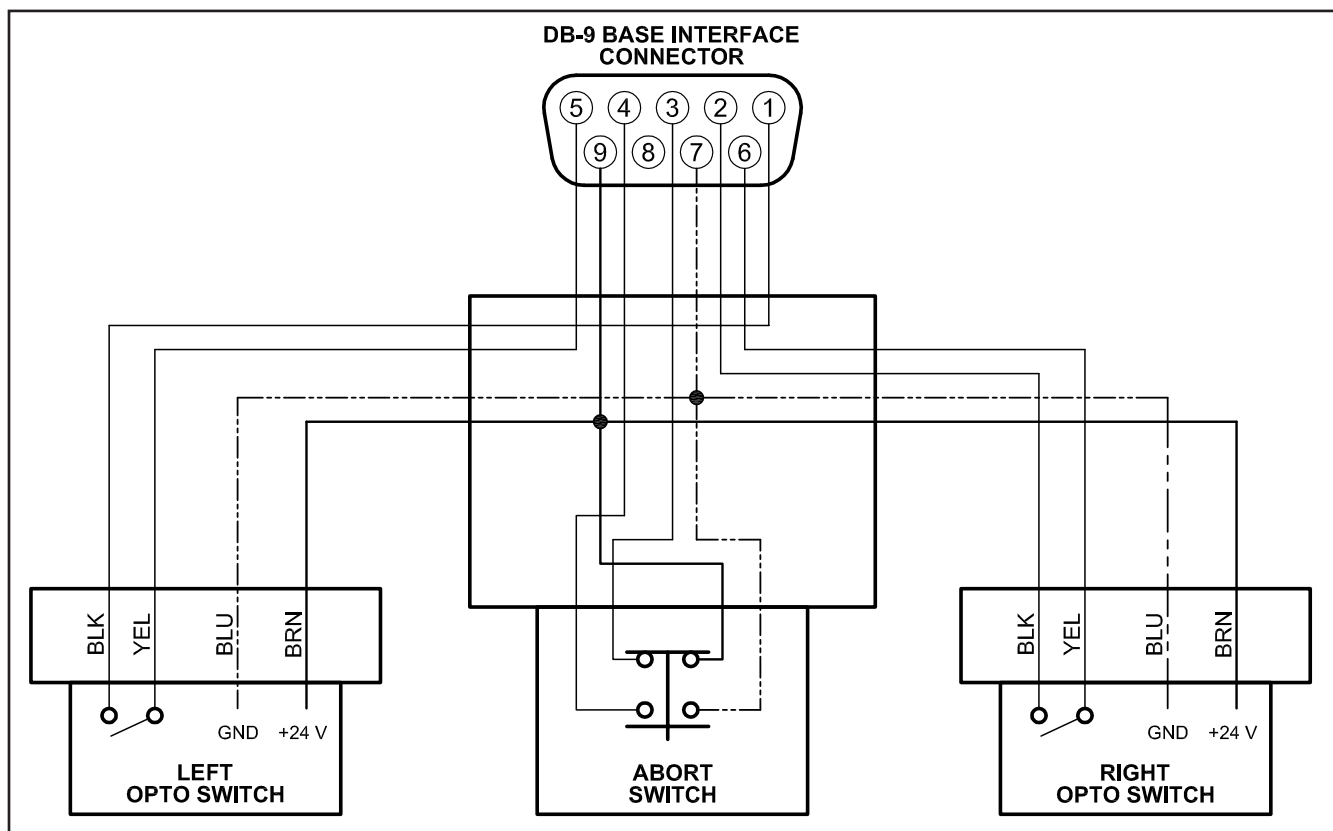

**Figure A-5** Schematic of Operate and Abort

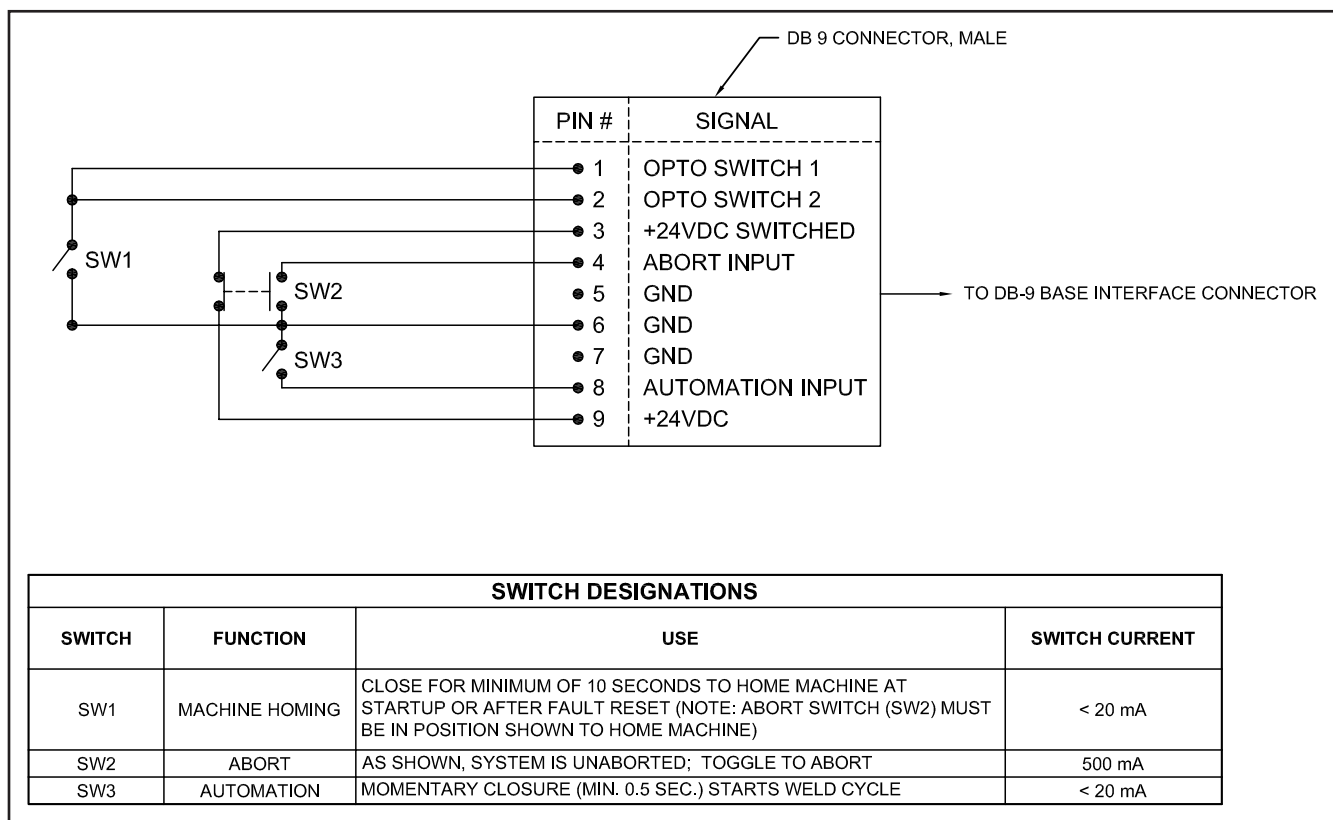

**Figure A-6** Wiring for Automation

*This page intentionally left blank*



# APPENDIX B

## Tooling

---

Moment of Inertia.....	105
Explanaton of Inertia .....	105
Calculating the Moment of Inertia .....	105
Tooling and Fixture Design .....	104

*This page intentionally left blank*

# Moment of Inertia

## Explanation of Inertia

The moment of inertia is a measure of the mass and the mass distribution of the tool. It is defined mathematically as the product of the mass times the distance of that mass from the axis of rotation squared. For a cylinder spinning around its axis, the formula for the moment of inertia is:

$$\text{Inertia} = 1/8 * M * D^2,$$

where

**Inertia is in  $kg\text{-}cm^2$**

**M is the mass in  $kg$**

**D is the cylinder diameter in  $cm$**

Taking into account material density, the formula can be rewritten as:

$$\text{Inertia} = .098 * \rho * L * D^4,$$

where

**$\rho$  is the density in  $kg/cm^3$**

**L is the cylinder length in  $cm$**

## Calculating the Moment of Inertia

For spin welder applications, most tools will have a geometry close to a cylinder with internal cutouts for the parts. To estimate the inertia of such a tool, first calculate the inertia of a solid cylinder, then the inertia of the void created for the part using the density of the tool material, and then subtract the two values.

### Example:

Aluminum tool with outside dimensions:

$$D = 4 \text{ in.} = 10.1 \text{ cm}$$

$$L = 2.5 \text{ in.} = 6.4 \text{ cm}$$

$$P = 0.1 \text{ lb/in.}^3 \text{ (density of}$$

$$\text{Aluminum}) = .0028 \text{ kg/cm}^3$$

Part void:

$$D = 3 \text{ inches} = 7.6 \text{ cm}$$

$$L = 1 \text{ inch} = 2.5 \text{ cm}$$

### USEFUL UNIT CONVERSIONS

$$1 \text{ in.} = 2.54 \text{ cm} = .025 \text{ m}$$

$$1 \text{ lb.} = 0.45 \text{ kg}$$

$$1 \text{ cm} = 0.39 \text{ in.}$$

$$1 \text{ m} = 39.4 \text{ in.}$$

$$1 \text{ kg} = 2.20 \text{ lb.}$$

*The inertia would be calculated as follows:*

$$\text{Inertia, cylinder} = .098 * .0028 * 6.4 * (10.1)^4 = 18.1 \text{ kg-cm}^2$$

$$\text{Inertia, void} = .098 * .0028 * 2.5 * (7.6)^4 = 2.3 \text{ kg-cm}^2$$

$$\text{Inertia, tool} = \text{Inertia, cylinder} - \text{Inertia, void} = 16 \text{ kg-cm}^2$$

# Tool and Fixture Design

The most important aspect of tool and fixture design is that it is safe. Please note that using tools not provided by Dukane may result in voiding of the warranty – consult Dukane for details.

Several aspects should be considered when tooling is not purchased from Dukane:

- tool nest should be designed such that part being held is firmly retained in the tool so that it does not fall out before being welded
- tool should surround part being held where possible – the exterior of the tool should be a continuous cylindrical surface (i.e. avoid protruding parts)
- rotational play between tool and part should be minimized – this will affect the angular orientation accuracy and repeatability
- tool should be as light as possible to allow for rapid deceleration and to keep machine energy consumption to a minimum
- tool should be balanced as accurately as possible to avoid excessive machine vibration and bearing wear
- bottom fixture should grip the part firmly to maintain accurate weld orientation and prevent undesirable vibrations during welding

# APPENDIX C

## Optional Features

---

Upper Tool Vacuum .....	109
Remote Touch Screen .....	110

*This page intentionally left blank*


## Upper Tool Vacuum

As an aid in holding the spinning part, the welder can optionally be equipped with vacuum in the upper tool. Two different kits are available: a complete vacuum system kit, which includes all components needed to generate, control, and transfer the vacuum to the tool (#438-963 for models SVT032VR & SVT042VR, #438-964 for model SVT012VR), and a vacuum transfer kit, which provides a means for transferring vacuum (not supplied) from a non-rotating fitting to the rotating tool (#438-952 for models SVT032VR & SVT042VR, #438-958 for model SVT012VR). The vacuum system kit is shown in Figure C-1 and the transfer kit in Figure C-2.


When vacuum is supplied to the 5/16" (8mm) air fitting shown in Figure C-2, it passes through the inside of the tooling hub and exits on the inside of the O-ring at the bottom. With holes between the top of the tool and the part cavity, the vacuum holds the part in the tool while it is spinning or at rest.

The welder is programmed to drive the vacuum on and off in one of two ways. With Part Pickup mode disabled, the vacuum signal (pin 5 on User I/O connector) is ON when the machine is ready to run a cycle, and OFF at the beginning of the hold phase. In this mode, the vacuum shuts off after a period of inactivity of 5 minutes to conserve air. To re-energize the vacuum, one of the RUN switches must be activated. With Part Pickup mode enabled, the vacuum signal (pin 2 on User I/O connector) is ON after pickup time elapses, and OFF at the end of the hold phase. Please refer to Table A-II for vacuum connection pinouts.

Additional details on the vacuum system are provided in Dukane document #403-580 (Servo Spin Welder Vacuum System User Guide).

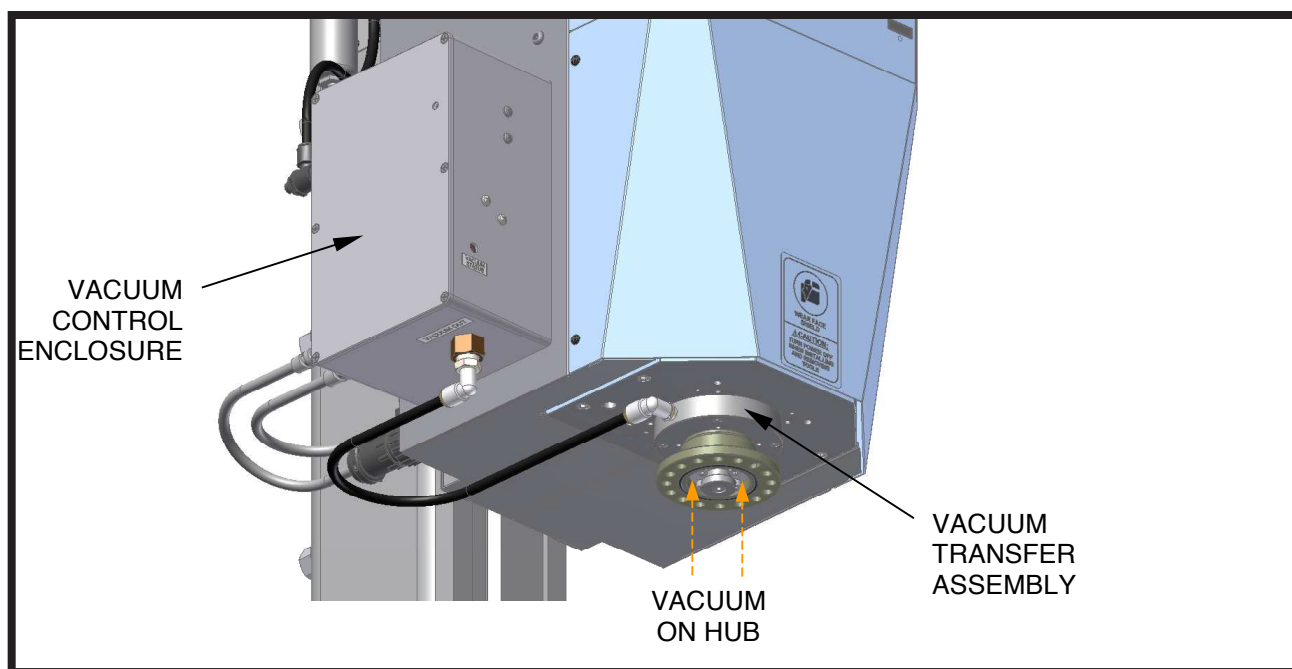


**Figure C-1** Upper Tool Vacuum System

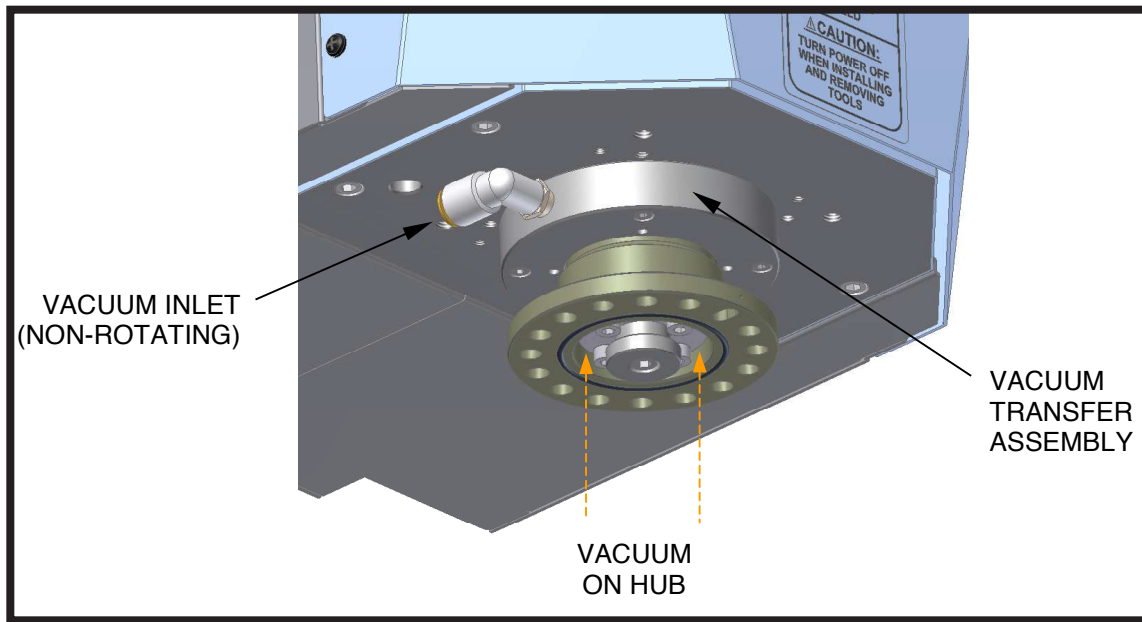

**Figure C-2** Upper Tool Vacuum Transfer Assembly

## Remote Touch Screen

In situations where it is desirable to provide access to the touch screen some distance away from the welder, the remote touch screen kit (#438-965) can be used. The touch screen is mounted in a separate enclosure as shown in Figure C-3, which can be up to 15 ft. (4.5 m) away from the welder. Two cables (power and communications) are needed to connect the touch screen with the welder. The enclosure includes mounting brackets for attachment to an external support (refer to Dukane drawing #400-2283 for dimensions). This kit can be used with any Dual Servo Spin Welder model.

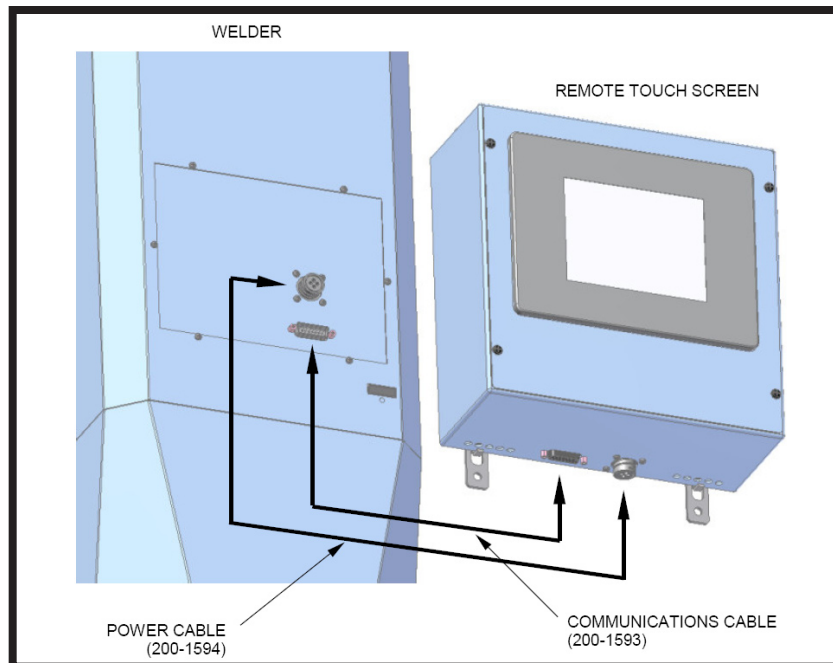

**Figure C-3** Remote Touch Screen Components



# Dukane ISO

---

## ISO CERTIFICATION

Dukane chose to become ISO 9001:2000 certified in order to demonstrate to our customers our continuing commitment to being a quality vendor. By passing its audit, Dukane can assure you that we have in place a well-defined and systematic approach to quality design, manufacturing, delivery and service. This certificate reinforces Dukane's status as a quality vendor of technology and products.

To achieve ISO 9001:2000 certification, you must prove to one of the quality system registrar groups that you meet three requirements:

1. Leadership
2. Involvement
3. Quality in Line Organizations and Quality System Infrastructure.

The ISO 9001:2000 standard establishes a minimum requirement for these requirements and starts transitioning the company from a traditional inspection-oriented quality system to one based on partnership for continuous improvement. This concept is key in that Dukane no longer focuses on inspection, but on individual processes.

Dukane's quality management system is based on the following three objectives:

1. Customer oriented quality. The aim is to improve customer satisfaction.
2. Quality is determined by people. The aim is to improve the internal organization and cooperation between staff members.
3. Quality is a continuous improvement. The aim is to continuously improve the internal organization and the competitive position.

**ISO 9001:2000  
CERTIFIED**

Dukane products are manufactured in ISO registered facilities.

---

**Please Refer to our Website At:**  
**[www.dukcorp.com/us/sales/intsales.htm](http://www.dukcorp.com/us/sales/intsales.htm)**  
**To Locate Your Local Representative**

